



# USER MANUAL

# KULLANIM KILAVUZU

*Monotig 160i Basic*



EN

DC INVERTER TIG WELDING MACHINE

TR

TIG KAYNAK İNVERTÖRÜ

(+90) 444 93 53  
magmaweld.com  
info@magmaweld.com

(+90) 538 927 12 62

**Customer Service / Müşteri Hizmetleri: (+90) 444 93 53**

**E-Mail / E-Posta: [info@magmaweld.com](mailto:info@magmaweld.com)**

**Organize Sanayi Bölgesi, 5. Kısım 45030 Manisa / TURKEY**

*All rights reserved. It is prohibited to reproduce this documentation, or any part thereof, without the prior written authorisation of Magma Mekatronik Makine Sanayi ve Ticaret A.Ş.*

*Magma Mekatronik may modify the information and the images without any prior notice.*

*Tüm hakları saklıdır. Magma Mekatronik Makine Sanayi ve Ticaret A.Ş.'nın yazılı izni olmaksızın bu dökümanın tamamının yada bir bölümünün kopyalanması yasaktır.*

*Magma Mekatronik önceden haber vermemeksizin bilgilerde ve resimlerde değişiklik yapılabilir.*

 **CONTENTS**

EN

<b>SAFETY PRECAUTIONS</b>	4
<b>1 TECHNICAL INFORMATION</b>	10
<b>1.1 General Information</b>	10
<b>1.2 Machine Components</b>	10
<b>1.3 Product Label</b>	11
<b>1.4 Technical Data</b>	12
<b>1.5 Accessories</b>	12
<b>2 INSTALLATION</b>	13
<b>2.1 Delivery Control</b>	13
<b>2.2 Installation And Operation Recommendations</b>	13
<b>2.3 Connections For TIG Welding</b>	14
<b>2.3.1 Mains Connection and Switching ON</b>	14
<b>2.3.2 Gas Connections</b>	14
<b>2.3.3 Torch Connections</b>	14
<b>2.3.4 Earth Clamp Connection</b>	14
<b>2.3.5 Welding Adjustments</b>	15
<b>2.3.6 Changing Tungsten Electrode</b>	15
<b>2.4 Connections For MMA Welding</b>	15
<b>3 MAINTENANCE AND SERVICE</b>	16
<b>3.1 Maintenance</b>	16
<b>3.2 Non-Periodic Maintenance</b>	16
<b>3.3 Troubleshooting</b>	16
<b>4 ANNEX 1 - SPARE PARTS LIST</b>	17
<b>5 ANNEX 2 - ELECTRICAL DIAGRAM</b>	18

## SAFETY PRECAUTIONS

### Be Sure To Follow All Safety Rules In This Manual!

#### **Explanation Of Safety**

#### **Information**



- Safety symbols found in the manual are used to identify potential hazards.
- When any one of the safety symbols are seen in this manual, it must be understood that there is a risk of injury and the following instructions should be read carefully to avoid potential hazards.
- The possessor of the machine is responsible for preventing unauthorized persons from accessing the equipment.
- Persons using the machine must be experienced or fully trained in welding; they have to read the user manual before operation and follow the safety instructions.

#### **Definition Of Safety Symbols**



#### **ATTENTION**

Indicates a potentially hazardous situation that could cause injury or damage. In case if no precaution is taken, it may cause injuries or material losses / damages.



#### **IMPORTANT**

Specifies notifications and alerts on how to operate the machine.



#### **DANGER**

Indicates a serious danger. In case if not avoided, severe or fatal injuries may occur.

#### **Comprehending Safety**

#### **Precautions**

- Read the user manual, the label on the machine and the safety instructions carefully.

- Make sure that the warning labels on the machine are in good condition. Replace missing and damaged labels.

- Learn how to operate the machine, how to make the checks in a correct manner.


- Use your machine in suitable working environments.

- Improper changes made in your machine will negatively affect the safe operation and its longevity.

- The manufacturer is not responsible for the consequences resulting from the operation of the device beyond the specified conditions.

#### **Electric Shocks May Kill**

**Make certain that the installation procedures comply with national electrical standards and other relevant regulations, and ensure that the machine is installed by authorized persons.**

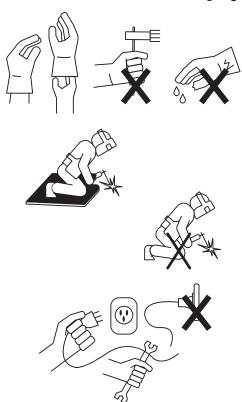

- Wear dry and sturdy insulated gloves and working apron. Never use wet or damaged gloves and working aprons.
- Do not touch the electrode with the bare hand.
- Never touch parts that carry electricity.
- Never touch the electrode if you are in contact with the electrode attached to the work surface, floor or another machine.
- By isolating yourself from the work surface and the floor, you can protect yourself from possible electric shocks. Use a non-flammable, electrically insulating, dry and undamaged insulation material that is large enough to cut off the operator's contact with the work surface.
- Do not connect more than one electrode to the electrode holder. Keep the machine turned off when not in use.
- Before repairing the machine, remove all power connections and/or connector plugs or turn off the machine.
- Be careful when using a long mains cable.
- Check all cables frequently for possible damage. If a damaged or an uninsulated cable is detected, repair or replace it immediately.
- Make sure that the grounding of the power line is properly connected.

**Moving Parts May****Cause Injuries**

- Keep away from the moving parts.

**Keep all protective devices such as covers, panels, flaps, etc., of machinery and equipment closed and in locked position.**

- Wear metal toe shoes against the possibility of heavy objects falling on to your feet.

**Smoke And Gases  
May Be Harmful To  
Your Health**

**Long-term inhalation of smokes and gases released from welding and cutting is very dangerous.**

- Burning sensations and irritations in the eyes, nose and throat are signs of inadequate ventilation. In such a case, immediately boost the ventilation of the work area, and if the problem persists, stop the welding process completely.
- Create a natural or artificial ventilation system in the work area.
- Use a suitable smoke extraction system where welding and cutting works are being carried out. If necessary, install a system that can expel fumes and gases accumulated in the entire workshop. Use a suitable filtration system to avoid polluting the environment during discharge.
- If you are working in narrow and confined spaces or if you are welding lead, beryllium, cadmium, zinc, coated or painted materials, use masks that provide fresh air in addition to the above precautions.
- If the gas tanks are grouped in a separate zone, ensure that they are well ventilated, keep the main valves closed when gas cylinders are not in use, pay attention to possible gas leaks.
- Shielding gases such as argon are denser than air and can be inhaled instead of air if used in confined spaces. This is dangerous for your health as well.
- Do not perform welding operations in the presence of chlorinated hydrocarbon vapors released during lubrication or painting operations.

**Arc Light May  
Damage Your Eyes****And Skin**

- Use a suitable protective mask and glass filter (4 to 13 according to EN 379) suitable for that to protect your eyes and face.

**Protect other naked parts of your body (arms, neck, ears, etc.) with suitable protective clothing from these rays.**

- Enclose your work area with flame-resistant folding screens and hang warning signs at eye level so that people around you will not sustain injuries from arc rays and hot metals.
- This machine is not used for heating of icebound pipes. This operation performed with the welding machine causes explosion, fire or damage to your installation.

**Sparks And Spattering Particles  
May Get Into Eyes And  
Cause Damage**

- Performing works such as welding, surface grinding, and brushing cause sparks and metal particles to splatter. Wear approved protective work goggles which have edge guards under the welding masks to prevent sustaining possible injuries

**Hot Parts May Cause  
Severe Burns**

- Do not touch the hot parts with bare hands.

**Wait until the time required for the machine to cool down before working on its parts.**

- If you need to hold hot parts, use suitable tools, welding gloves with high-level thermal insulation and fire-resistant clothes.

**Noise May Cause****Damage To Your****Hearing Ability**

- The noise generated by some equipment and operations may damage your hearing ability.

**Wear approved personal ear protective equipment if the noise level is high.**

**Welding Wires Can Cause Injuries**



- Do not point the torch towards any part of the body, other persons, or any metal while unwrap ping the welding wire.
- When welding wire is run manually from the roller especially in thin diameters the wire can slip out of your hand, like a spring or can cause damage to you or other people around, therefore you must protect your eyes and face while working on this.

**Welding Operations May Cause Fire And Explosion**



- Never perform welding work in places near flammable materials. There may be fire or explosions.
- Before starting the welding work, remove these materials form the environment or cover them with protective covers to prevent combustions and flaring.
- National and international special rules apply in these areas.
- Do not apply welding or cutting operations into completely closed tanks or pipes.
- Before welding to tanks and closed containers, open them, completely empty them, clean them and clean them. Pay the greatest attention possible to the welding operations you will perform in such places.
- Do not weld in tanks and pipes which might have previously contained substances that may cause explosions, fires or other reactions.
- Welding equipment heats up. For this reason, do not place it on surfaces that could easily burn or be damaged !
- Welding sparks can cause fire. For this reason, keep materials such as fire extinguishers tubes, water, and sand in easily accessible places.
- Use holding valves, gas regulators and valves on flammable, explosive and compressed gas circuits. Make sure that they are periodically inspected and pay attention that they run reliably.

**Maintenance Work Performed By Unauthorized Persons To Machines And Apparatus May Cause Injuries**



- Electrical equipment should not be repaired by unauthorized persons. Errors occurred if failed to do so may result in serious injury or death when using the equipment.
- The gas circuit elements operate under pressure; explosions may occur as a result of services provided by unauthorized persons , users may sustain serious injuries.
- It is recommended to perform technical maintenance of the machine and its auxiliary units at least once a year.

**Welding In Small Sized And Confined Spaces**



- In small-sized and confined spaces, absolutely make sure to perform welding and cutting operations, accompanied by another person.
- Avoid performing welding and cutting operations in such enclosed areas as much as possible.

**Failure To Take Precautions During Transport May Cause Accidents**



- Take all necessary precautions when moving the machine. The areas where the machine to be transported, parts to be used in transportation and the physical conditions and health of the person carrying out the transportation works should be suitable for the transportation process.
- Some machines are extremely heavy; therefore, make sure that the necessary environmental safety measures are taken when changing their places.
- If the welding machine is to be used on a platform, it must be checked that this platform has suitable load bearing limits.
- If it is to be transported by means of a haulage vehicle (transport trolley, forklift etc.), make sure of the durableness of the vehicle, and the connection points (carrying suspenders, straps, bolts, nuts, wheels, etc.) that connect the machine to this vehicle.
- If the machine will be carried manually, make sure the durableness of the machine apparatuses (carrying suspenders, straps, etc.) and connections.
- Observe the International Labor Organization's rules on carriage weights and the transport regulations in force in your country in order to ensure the necessary transport conditions.

- Always use handles or carrying rings when relocating the power-supply sources.
- Never pull from torches, cables or hoses. Be absolutely sure to carry gas cylinders separately.
- Remove all interconnections before transporting the welding and cutting equipment, each being separately, lift and transport small ones using its handles, and the big ones from its handling rings or by using appropriate haulage equipment, such as forklifts.

**Falling Parts May Cause Injuries**



**Improper positioning of the power-supply sources or other equipment can cause serious injury to persons and physical damage to other objects.**

- Place your machine on the floor and platforms with a maximum tilt of 10° so that it does not fall or tip over. Choose places that do not interfere with the flow of materials, where there is no risk of tripping over on cables and hoses; yet, large, easily ventilatable, dust-free areas. To prevent gas cylinders from tipping over, on machines with a gas platform suitable for the tanks, fix the tanks on to the platform; in stationary usage applications, fix them to the wall with a chain in a way that they would not tip over for sure.
- Allow operators to easily access settings and connections on the machine.

**Excessive Use Of The Machine Causes Overheating**



- Allow the machine to cool down according to operation cycle rates.
- Reduce the current or operation cycle rate before starting the welding again.
- Do not block the fronts of air vents of the machines.
- Do not put filters that do not have manufacturer approvals into the machine's ventilation ports.

**Excessive Use Of The Machine Causes Overheating**



- This device is in group 2, class A in EMC tests according to TS EN 55011 standard.
- This class A device is not intended for use in residential areas where electrical power is supplied from a low-voltage power supply. There may be potential difficulties in providing electromagnetic compatibility due to radio frequency interference transmitted and emitted in such places.



This device is not compliant with IEC 61000-3-12. In case if it is desired to be connected to the low voltage network used in the home, the installer to make the electrical connection or the person who will use the machine must be aware that the machine has been connected in such a manner; in this case the responsibility belongs to the user.

- Make sure that the work area complies with electromagnetic compatibility (EMC). Electromagnetic interferences during welding or cutting operations may cause undesired effects on your electronic devices and network; and the effects of these interferences that may occur during these operations are under the responsibility of the user.
- If there is any interference, to ensure compliance; extra measures may be taken, such as the use of short cables, use of shielded (armored) cables, transportation of the welding machine to another location, removal of cables from the affected device and/or area, use of filters or taking the work area under protection in terms of EMC.
- To avoid possible EMC damage, make sure to perform your welding operations as far away from your sensitive electronic devices as possible (100m).
- Ensure that your welding and/or cutting machine has been installed and situated in its place according to the user manual.

**Evaluation Of Electromagnetic****According to article 5.2 of IEC 60974-9;****Suitability Of The  
Work Area**

Before installing the welding and cutting equipment, the person in charge of the operation and/or the user must conduct an inspection of possible electromagnetic interference in the environment. Aspects indicated below has to be taken into consideration;

- a) Other supply cables, control cables, signal and telephone cables, above and below the welding machine and its equipment,
- b) Radio and television transmitters and receivers,
- c) Computer and other control hardware,
- d) Critical safety equipment, e.g. protection of industrial equipment,
- e) Medical apparatus for people in the vicinity, e.g. pacemakers and hearing aids,
- f) Equipment used for measuring or calibration,
- g) Immunity of other equipment in the environment. The user must ensure that the other equipment in use in the environment is compatible. This may require additional protection measures.
- h) Considering the time during which the welding operations or other activities take place during the day, the boundaries of the investigation area can be expanded according to the size of the building, the structure of the building and other activities that are being performed in the building.

In addition to the evaluation of the field, evaluation of device installations may also be necessary for solving the interfering effect.

In case if deemed necessary, on-site measurements can also be used to confirm the efficiency of mitigation measures. (Source: IEC 60974-9).

**Electromagnetic Interference  
Reduction Methods**

- The appliance must be connected to the electricity supply in the recommended manner by a competent person. If interference occurs, additional measures may be applied, such as filtering the network. The supply of the fixed-mounted arc welding equipment must be made in a metal tube or with an equivalent shielded cable. The housing of the power supply must be connected and a good electrical contact between these two structures has to be provided.
- The recommended routine maintenance of the appliance must be carried out. All covers on the body of the machine must be closed and/or locked when the device is in use. Any changes, other than the standard settings without the written approval of the manufacturer, cannot be modified on the appliance. Otherwise, the user is responsible for any consequences that may possibly occur.
- Welding cables should be kept as short as possible. They must move along the floor of the work area, in a side by side manner. Welding cables should not be wound in any way.
- A magnetic field is generated on the machine during welding. This may cause the machine to pull metal parts on to itself. To avoid this attraction, make sure that the metal materials are at a safe distance or fixed. The operator must be insulated from all these interconnected metal materials.
- In cases where the workpiece cannot be connected to the ground due to electrical safety, or because of its size and position (for example, in building marine vessel bodies or in steel construction manufacturing), a connection between the workpiece and the grounding may reduce emissions in some cases, it should be kept in mind that grounding of the workpiece may cause users to sustain injuries or other electrical equipment in the environment to break down. In cases where necessary, the workpiece and the grounding connection can be made as a direct connection, but in some countries where direct connection is not permissible, the connection can be established using appropriate capacity elements in accordance with local regulations and ordinances.
- Screening and shielding of other devices and cables in the work area can prevent aliasing effects. Screening of the entire welding area can be evaluated for some specific applications.

**Arc Welding May Cause Electromagnetic Field (EMF)** The electrical current passing through any conductor generates zonal electric and magnetic fields (EMF). All welders must follow the following procedures to minimize the risk of exposure to EMF from the welding circuit;



- In the name of reducing the magnetic field, the welding cables must be assembled and secured as far as possible with the joining materials (tape, cable ties etc.).
- The welder's/worker's body and head should be kept as far away from the welding machine and cables as possible,
- Welding cables should not be wrapped around the body of the machine in any way,
- The body of the machine should not get caught between the welding cables. The source cables must be kept away from the body of the machine, both being placed side by side,
- The return cable must be connected to the workpiece as close as possible to the welded area,
- The welding machine should not rest against the power unit, ensconce on it and not work too close to it,
- Welding work should not be performed when carrying the welding wire supply unit or welding power unit.

EMF may also disrupt the operation of medical implants (materials placed inside the body), such as pacemakers. Protective measures should be taken for people who carry medical implants. For example, access limitation may be imposed for passers-by, or individual risk assessments may be conducted for welders. Risk assessment should be conducted and recommendations should be made by a medical professional for users who carry medical implants.

**Protection** • Do not expose the machine to rain, prevent the machine from splashing water or pressurized steam.



**Energy Efficiency** • Choose the welding method and welding machine for the welding work you are to perform.  
• Select the welding current and/or voltage to match the material and thickness you are going to weld.  
• If you have to wait for a long time before you start your welding work, turn off the machine after the fan has cooled it down. Our machines (our products) with smart fan control will turn off on their own.



**Waste Procedure** • This device is not domestic waste. It must be directed to recycling within the framework of the European Union directive and national laws.  
• Obtain information from your dealer and authorized persons about the waste management of your used machines.

## TECHNICAL INFORMATION

### 1.1 General Information

Monotig 160i Basic, is an inverter type portable, mono-phase DC MMA welding machine designed to weld Rutile and Basic electrodes up to 3.25 mm. This unit can also be used as a DC TIG\* power source for touchstart applications. Even though the machine is mono-phase, due to the inverter technology it provides stable arc and good re-striking performance, Monotig 160i Basic, proved well that it can work between 185 to 250 V 50/60 Hz line voltages. and the machine welds with generator-sets.

Due to antistick option welding machine cuts the output current off. In case of adhesion between electrode and surface and it provides to separate, electrode from the surface easily.

Monotig 160i Basic, can also be used with long welding cables up to 25 mt. The machine is fan cooled and thermally protected against over heating.

### 1.2 Machine Components

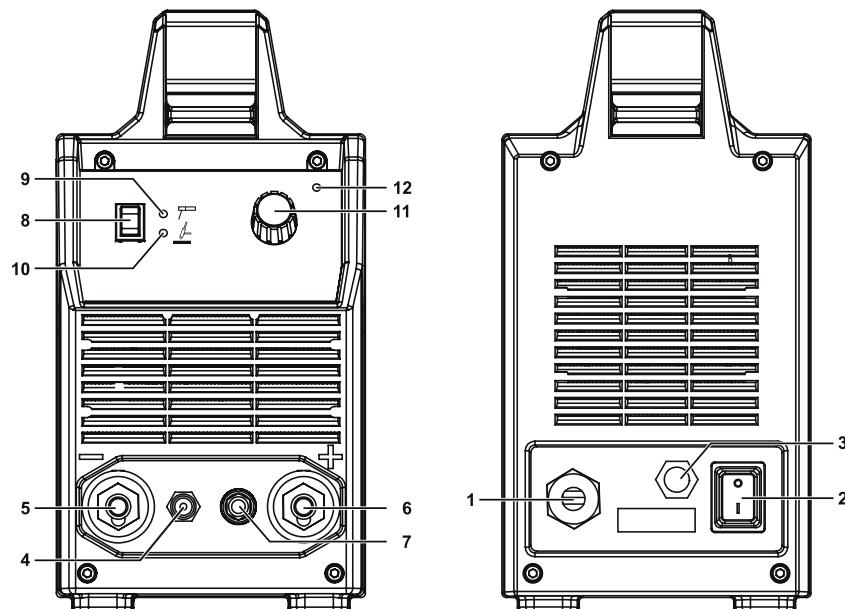


Figure 1: Monotig 160i Basic


- |  |                                    |
|--|------------------------------------|
| 1-Line Cable Inlet                         | 7-Torch Control Connections        |
| 2-Power Switch                             | 8-Welding Select Switch            |
| 3-Gas Inlet                                | 9-MMA Welding LED                  |
| 4-Gas Outlet                               | 10-TIG welding LED                 |
| 5-Earth Cable and Welding Cable Socket (-) | 11-Multifunctional Adjustment Knob |
| 6-Earth Cable and Welding Cable Socket (+) | 12-Thermic / Error LED             |

### 1.3 Product Label

<b>MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.</b> <b>Organize Sanayi Bölgesi 5.Kısim Manisa-TÜRKİYE</b>		
<b>MONOTIG 160i BASIC</b>		Seri No:
		EN 60974-1 / EN 60974-10 Class A
		10A / 10.4V - 160A / 16.4V
	X	20% 60% 100%
	I <sub>2</sub>	160A 92A 72A
		U <sub>2</sub> 16.4V 13.7V 12.9V
	I <sub>1</sub>	22.4A 11.2A 8.4A
	S <sub>1</sub>	5.2kVA 2.6kVA 1.9kVA
	I <sub>max</sub> = 22.4A      I <sub>eff</sub> = 10A	
		10A / 20.4V - 160A / 26.4V
	X	20% 60% 100%
	I <sub>2</sub>	160A 92A 72A
		U <sub>2</sub> 26.4V 23.7V 22.9A
	I <sub>1</sub>	34A 17.5A 13.5A
	S <sub>1</sub>	7.8kVA 4kVA 3.1kVA
		I <sub>max</sub> = 34A      I <sub>eff</sub> = 15.2A
	IP23S	

	Single Phase Transformer Rectifier
	TIG Welding
	Manual Metal Arc Welding
	Direct Current
	Descending Characteristics
	Mains Input-1 Phase Alternating Current
	Suitable for operation at hazardous environments
X	Duty Cycle
U <sub>0</sub>	Open Circuit Voltage
U <sub>1</sub>	Line Voltage and Frequency
U <sub>2</sub>	Rated Welding Voltage
I <sub>1</sub>	Input Current
I <sub>2</sub>	Rated Welding Current
IP23S	Protection Class
S <sub>1</sub>	Input Power

Working Cycle  
Temperature (°C)

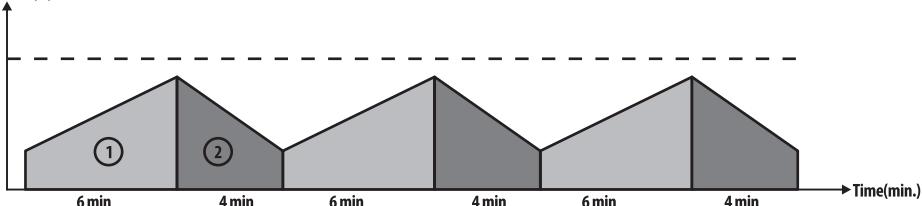

As defined in the standard EN 60974-1, the operating cycle rate includes a time period of 10 minutes. For example, if a machine specified as 250A at %60 is to be operated at 250A, the machine can weld without interruption in the first 6 minutes of the 10 minute period(zone 1). However, the following 4 minutes should be kept idle for the machine cool down (zone 2).

## 1.4 Technical Data

TECHNICAL DATA	UNIT	VALUE
Line Voltage (1 phase 50-60Hz)	V	230
Input Power - TIG (20%)	kVA	5,2
Input Power - MMA (20%)	kVA	7,8
Input Current - TIG (20%)	A	22,4
Input Current - MMA (20%)	A	34
Power Factor		0,66
Open Circuit Voltage		65
Welding Current Range - TIG	VDC	10-160
Welding Current Range - MMA	ADC	10-160
Rated Welding Current - TIG (20%)	ADC	160
Rated Welding Current - MMA (20%)	ADC	160
Protection Class		IP23S
Cooling Method		Air
Dimensions (LxWxH)	mm	450x160x312
Weight	kg	9,5
Standards and Approvals		CE, EN60974-1, EN60974-10

## 1.5 Accessories

STANDARD ACCESSORIES	QTY	PRODUCT CODE
Workpiece Clamp and Cable	1	7905201603
Electrode Clamp and Cable	1	7906201603
Gas Hose	1	7907000002
Torch (Air Cooled 4m)	1	7011100004
OPTIONAL ACCESSORIES	QTY	PRODUCT CODE
Water Cooling Unit (CSP 40)	1	7910005200
Gas Regulator	1	7020001004
Foot Pedal (On/Off)	1	7910000130
Trolley	1	7910000100

## INSTALLATION

EN

### 2.1 Delivery Control

To unpack your purchased welding machine to comply with the truck transport regulations, first tear the cutter, then cut the ring and lift the machine down the pallet to comply with the truck transport regulations. Make sure you receive your order in full. If any material is missing or damaged, contact your place of purchase immediately.

The standard pallet includes:

- Power Source
- TIG Torch Plug
- Electrode Holder Cable
- Transportation Belt
- Earth Clamp Cable
- User Manual

In the case of a damaged delivery, draw up a record, take a picture of the damage and report to the transport company together with a photocopy of the delivery note. If the problem persists, contact the customer service.

### Symbols and their meanings on the device;



Welding process is dangerous. Proper working conditions should be ensured and necessary precautions should be taken. Specialists are responsible for the machine and have to be equipped with the necessary equipment. Irrelevant persons should be kept away from the welding area.



This device is not compatible with IEC 61000-3-12. If it is desired to connect to the low voltage mains used in homes, it is essential that the installer or the person who will operate the machine to make the electrical connection has information on the machine's connectivity. In this case the responsibility will be assumed by the person who will perform the installation or by the operator.



The safety symbols and warning notes on the device and in the operating instructions must be observed and the labels must not be removed.



Grids are intended for ventilation. The openings should not be covered in order to provide good cooling and no foreign objects should be inserted.

### 2.2 Installation And Operation Recommendations

- Necessary precautions should be taken during transportation of the machine. Do not lift the machine with the gas cylinder. Place the power supply on a hard, level and level surface where it will not fall or tip over.
- For better performance, place the machine at least 30 cm away from surrounding objects. Pay attention to overheating, dust and moisture around the machine. Do not operate the machine in direct sunlight. When the ambient temperature exceeds 40°C, operate the machine at a lower current or at a lower cycle rate.
- Avoid welding with wind and rain outdoors. If welding is required in such cases, protect the welding area and the welding machine with curtains and awnings.
- When positioning the machine, make sure that materials such as walls, curtains, panels, etc. do not impede easy access to the controls and connections of the machine.
- If welding inside, use a suitable smoke extraction system. Use breathing apparatus if there is a risk of inhaling welding fumes and gas indoors.
- Observe the duty cycle rates specified on the product label. Frequent exceeding duty cycle rates can damage the machine and void the warranty.
- Use the appropriate fuse for your system.
- Connect the ground wire as close to the welding area as possible. Do not allow welding current to pass through elements other than welding cables, eg the machine itself, the gas cylinder, the chain, the bearing.
- When the gas cylinder is placed on the machine, immediately fasten the chain to secure the gas cylinder. If you do not place the gas cylinder on the machine, fasten it to the wall with a chain.
- The electrical outlet on the back of the machine is for the CO<sub>2</sub> heater. NEVER connect a device other than a CO<sub>2</sub> heater to the CO<sub>2</sub> socket!

## 2.3 Connections For TIG Welding

### 2.3.1 Mains Connection and Switching ON



**Before plugging your machine to the electrical line, check the line voltage [230 VAC].**

- Switch the machine to the position "OFF"/"0" and insert the plug into the socket.
- SWITCH ON the machine via power switch (2). Observe that the switch itself and the led displays in the front panel lits, also you should hear the sound of the cooler fan.

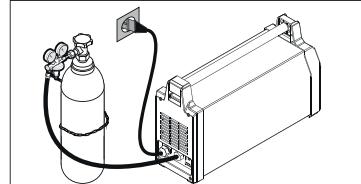


Figure 2: Gas and Mains Connections

### 2.3.1 Mains Connection and Switching ON

- Secure the gas cylinder (11) to a wall by a chain. To operate safely and get best results, use approved regulators.
- Open the gas cylinder valve (13) few times in order to blow out any possible dirt or particles.
- Connect the gas regulator to the cylinder, make sure that the threading of the gas outlet of the cylinder and the nut of the regulator match.

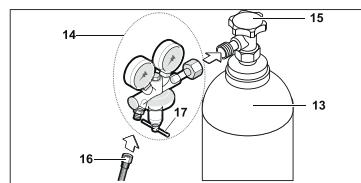


Figure 3: Gas Cylinder - Regulator - Hose Connections

### 2.3.3 Torch Connections

- Screw the TIG torchs ring nut (17) to the TIG welding connector (4).
- Connect torch connector (19) to the trigger control connector (7).

### 2.3.4 Earth Clamp Connection

- Insert the earth clamp socket (20) through the Plus signed plug (6) and turn it right tightly.
- To improve the quality of welding proces tie earth clamp (21) as close as and tightly to the working piece.

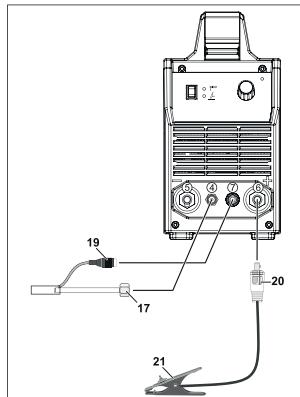


Figure 4: TIG Welding Connections

### 2.3.5 Welding Adjustments

- Select Tig welding position from welding mode selection switch (8).
- Adjust welding current, using welding current adjustment pot (11).
- Adjust flow rate for the gas with using pressure adjustment valve (15).
- Its ready for tig welding process.

Diameter of Electrode (mm)	Diameter of Nozzle (mm)	Welding Current (ADC)	Gas Debit (lt/dak)
1.0	6.3	30 - 70	6 - 8
1.6	9.5	30 - 150	6 - 8

### 2.3.6 Changing Tungsten Electrode

- Unscrew the clamping cap (23).
- Remove the existing tungsten electrode (22) from the collet (24) and insert the new electrode in.
- Insert the collet (24) into the torch.
- Screw the clamping cap (23) tightly.
- The ceramic gas nozzle (22) and the tungsten electrode (22) diameters should be selected according to the working current and the shape of the work-piece. Therefore the collet (24), the collet body (25) must be matched with the diameter of the tungsten electrode (22).

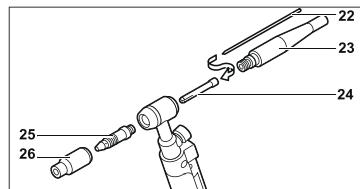


Figure 5: Changing the Tungsten Electrode


### 2.4 Connections For MMA Welding

- Switch ON the machine by following the steps 2.3.1.
- According to the polarity of the electrode to be used, insert the electrode holder cable and the earth clamp cable plugs into their appropriate sockets (5-6) and tighten them by turning clockwise.
- Connect the earth clamp tightly to the work-piece as close as possible to the welding area.
- Adjust the desired current and the machine is ready to weld.
- Below table is given as a reference for current adjustment of mild steel electrodes, please refer to the electrode manufacturer's recommendations.

Diameter	Rutile	Basic	Cellulosic
2.0	40-60 A	-	-
2.5	60-90 A	60-90 A	60-100 A
3.25	100-140 A	100-130 A	70-130 A
4.0	140-180 A	140-180 A	120-170 A

## MAINTENANCE AND SERVICE


- Strictly follow the instructions contained in safety rules while servicing the machine.
- Before removing any screw on the machine for maintenance, power supply must be disconnected from the electric lines and enough time should be allowed for capacitor discharging.

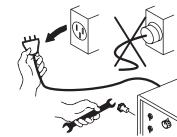

### 3.1. Maintenance


#### Every 3 Months

- Do not remove the warning labels on the device. Replace the worn/torn labels with the new ones. Labels can be obtained from the authorized service.
- Check your clamps and cables. Pay attention to the connections and the durableness of the parts. Replace the damaged/defective parts with the new ones. Do not ever make additions to/repair the cables.

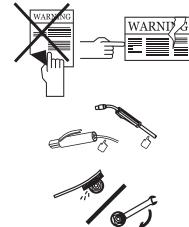


#### Every 6 Months

- Clean and tighten fasteners such as bolts and nuts.
- Check the electrode clamp and grounding clamp cables.
- Open the side covers of the machine and clean with low pressure dry air. Do not apply compressed air to electronic components at close distance

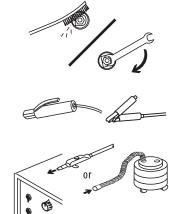

### 3.2 Non-Periodic Maintenance

- The consumables on the torch should be cleaned regularly. It should be replaced if necessary. Make sure that these materials are original products for long-term use.

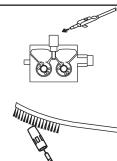

**NOTE:** The above mentioned periods are the maximum ones that should be applied if no problems are encountered in your device. Depending on the work load and contamination of your work environment, you can repeat the above processes more frequently.



Never operate the machine when covers are open.


### 3.3 Troubleshooting

- If the Thermal Protection LED (10) lights up while cooling fan is working and the machine doesn't weld; machine maybe overheated and stopped for auto protection due to overheat. Hot weather or working in high current values for long time may cause this. Let the machine on for a while in order to cool down itself with the cooling fan. After it cools enough, Thermal Protection LED (10) fades away and the machine can weld.
- When the lamp of power switch (2) is lighting, cooling fan is working but the machine does not weld; turn off the machine for 1 minute then turn it on again and try to weld. If it still doesn't weld, contact to your authorized technical service.




## ANNEX 1 - SPARE PARTS LIST

EN

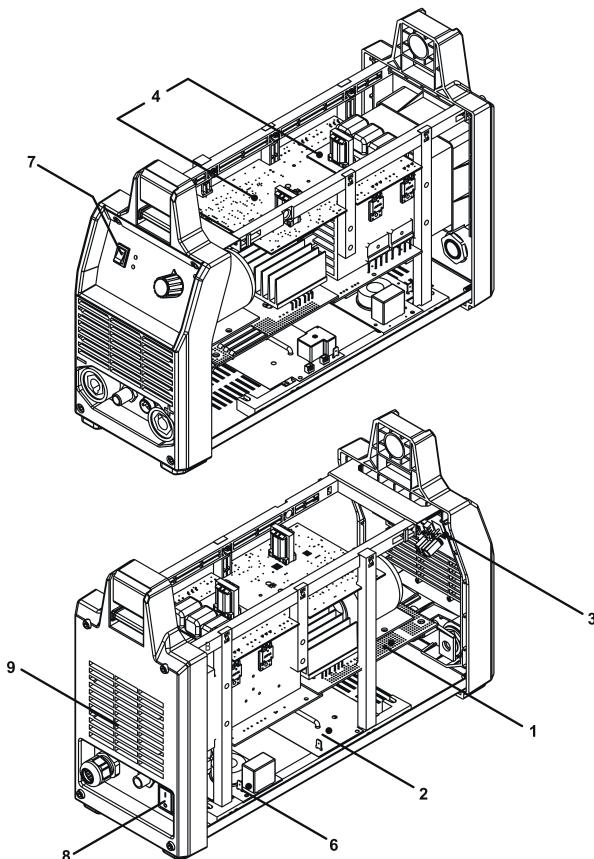

NO	DEFINITION	CIRCUIT CHART	MATERIAL CODE
1	Electronic Card - Power	E203A PWR	K405000178
2	Electronic Card - Relay Card	E203A	K405000220
3	Electronic Card - Panel	E502A-4	K405000148
4	Electronic Card - Control	TIG BASIC E213A CNT	K405000239
5	Electronic Card - Capacitor	E203A PWR PFC	K405000222
6	Electronic Card - Filter	E201B-FLT	K405000101
7	Source Mode Select Button	Rocker Switch	A310100009
8	On / Off Switch	Power	A310100008
9	Fan	Fan	A250200026

**EN** + ANNEX 2 - ELECTRICAL DIAGRAM

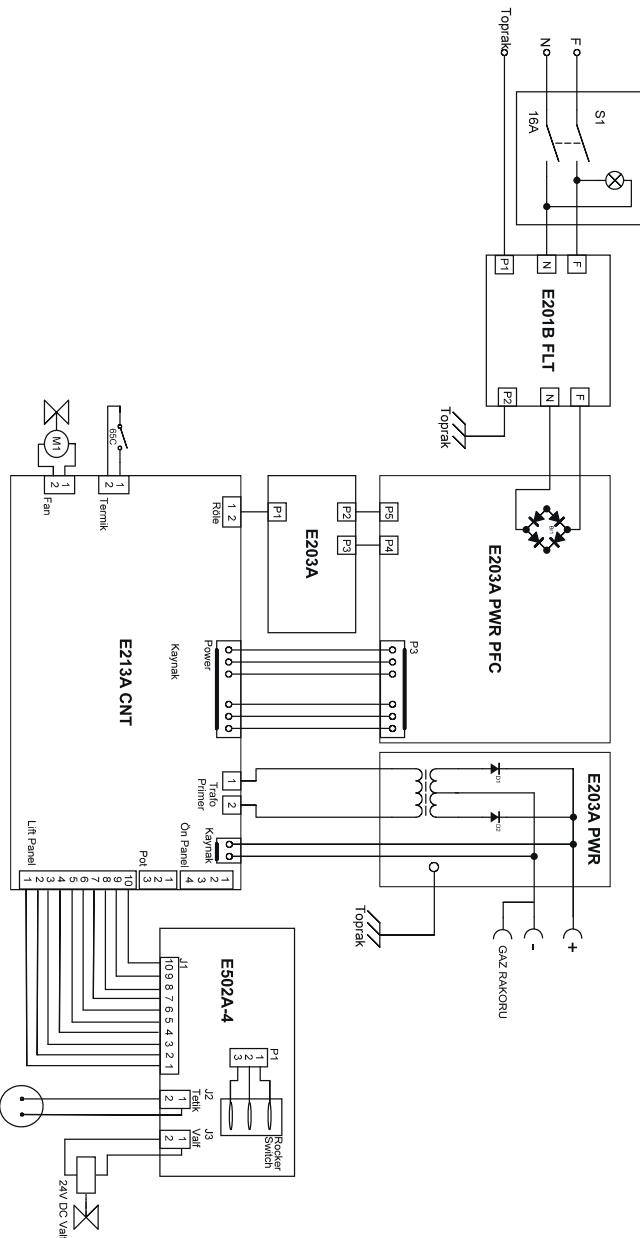

 **İÇİNDEKİLER**

GÜVENLİK KURALLARI	20
1 TEKNİK BİLGİLER	26
1.1 Genel Açıklamalar	26
1.2 Makine Bileşenleri	26
1.3 Ürün Etiketi	27
1.4 Teknik Özellikler	28
1.5 Aksesuarlar	28
2 KURULUM BİLGİLERİ	29
2.1 Teslim Alırken Dikkat Edilecek Hususlar	29
2.2 Kurulum Ve Çalışma Tavsiyeleri	29
2.3 TIG Kaynağı	30
2.3.1 Makineyi Şebekeye Bağlayın Ve Çalıştırın	30
2.3.2 Gaz Bağlantıları	30
2.3.3 Torç Bağlantıları	30
2.3.4 Topraklama Pensesi Bağlantıları	30
2.3.5 Kaynak Ayarları	31
2.3.6 Tungsten Elektrod Değiştirme	31
2.4 Örtülü Elektrod Kaynağı	31
3 BAKIM VE ARIZA BİLGİLERİ	32
3.1 Bakım	32
3.2 Periyodik Olmayan Bakımlar	32
3.3 Hata Giderme	32
4 EK 1 - YEDEK PARÇA LİSTESİ	33
5 EK 2 - DEVRE ŞEMASI	34

TR

## GÜVENLİK KURALLARI

TR

### Kılavuzda Yer Alan Tüm Güvenlik Kurallarına Uyun!

#### Güvenlik Bilgilerinin Tanımlanması

##### Tanımlanması



- Kılavuzda yer alan güvenlik sembollerini potansiyel tehlikelerin tanımlanmasında kullanılır.
- Bu kılavuzda herhangi bir güvenlik simgesi görüldüğünde, bir yaralanma riski olduğu anlaşılmalı ve takip eden açıklamalar dikkatlice okunarak clası tehlikeler engellenmelidir.
- Makine sahibi, yetkisiz kişilerin ekipmana erişmesini engellemekten sorumludur.
- Makineyi kullanan kişiler kaynak konusunda deneyimli veya tam eğitimli kişiler olup; çalışma öncesinde kullanma kılavuzunu okumalı ve güvenlik uyarlarına uymalıdır.

#### Güvenlik Sembollerinin Tanımlanması



##### DİKKAT

Yaralanma ya da hasara neden olabilecek potansiyel tehlikeli bir durumu belirtir. Önlem alınmaması durumunda yaralanmalara veya maddi kayıplara/hasarlara neden olabilir.



##### ÖNEMLİ

Kullanıma yönelik bilgilendirmeleri ve uyarıları belirtir.



##### TEHLİKE

Ciddi tehlike olduğunu gösterir. Kaçınılmaması durumunda ölüm veya ağır yaralanmalar meydana gelebilir.


#### Güvenlik Uyarılarının Kavranması

- Kullanım kılavuzunu, makine üzerindeki etiket ve güvenlik uyarılarını dikkatli bir şekilde okuyunuz.
- Makine üzerindeki uyarı etiketlerinin iyi durumda olduğundan emin olunuz. Eksik ve hasarlı etiketleri değiştiriniz.
- Makinenin nasıl çalıştırıldığını, kontrollerinin doğru bir şekilde nasıl yapılacağıını öğreniniz.
- Makinenizi uygun çalışma ortamlarında kullanınız.
- Makinenizde yapılabilecek uygunsuz değişiklikler makinenizin güvenli çalışmasına ve kullanım ömrüne olumsuz etki eder.
- Cihazın belirtilen koşullar dışında çalıştırılmasından doğan sonuçlardan üretici sorumlu değildir.

#### Elektrik Çarpmaları Öldürebilir



**Kurulum prosedürlerinin ulusal elektrik standartlarına ve diğer ilgili yönetmeliklere uygun olduğunu emin olun ve makinenin yetkili kişiler tarafından kurulmasını sağlayın.**

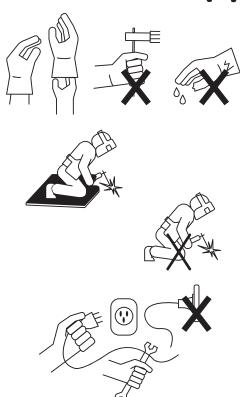

- Kuru ve sağlam izolasyonlu eldiven ve iş önlüğü giyin. İslak ya da hasar görmüş eldiven ve iş önlüklerini kesinlikle kullanmayın.
- Elektroda çiplak elle dokunmayın.
- Elektrik taşıyan parçalara kesinlikle dokunmayın.
- Eğer çalışma yüzeyine, zemine ya da başka bir makineye bağlı elektrodlu temas halindeyseniz kesinlikle elektroda dokunmayın.
- Çalışma yüzeyinden ve zeminden kendinizi izole ederek olası muhtemel elektrik şoklarından koruna bilirsiniz. Çalışma yüzeyiyle operatörün temasını keserek kadar büyük, yanmaz, elektriksiz açdan yalıtkan, kuru ve hasarsız izolasyon malzemeleri kullanın.
- Elektrot pensine birden fazla elektrot bağlamayın.
- Makineyi kullanmadığınız durumlarda kapalı tutun.
- Makineyi tamir etmeden önce tüm güç bağlantılarını ve/veya bağlantı fışlarını çıkartın ya da makineyi kapatın.
- Uzun şebeke kablosu kullanırken dikkatli olun.
- Tüm kabloları olası hasarlarla karşı sık sık kontrol edin. Hasarlı ya da izolasyonsuz bir kablo tespit edildiğinde derhal tamir edin veya değiştirin.
- Elektrik hattının topraklamasının doğru yapıldığından emin olun.

**Hareketli Parçalar Yaralanmaları****Yol Açıabilir**

- Hareket halinde olan nesnelerden uzak durun.

- Makine ve cihazlara ait tüm kapak, panel, kapı, vb. koruyucuları kapalı ve kilitli tutun.
- Ağır cisimlerin düşme olasılığuna karşı metal burunlu ayakkabı giyin.

**Duman ve Gazlar****Sağlığınıza İçin****Zararlı Olabilir**

**Kaynak ve kesme işlemi yapılmırken çıkan duman ve gazın uzun süre solunması çok tehlikelidir.**

- Gözlerde, burunda ve boğazda meydana gelen yanma hissi ve tahlıller, yetersiz havalandırmayı belirtirlerdir. Böyle bir durumda derhal havalandırmayı arttırın, sorunun devam etmesi halinde kaynak işlemini durdurun.
- Çalışma alanında doğal ya da suni bir havalandırma sistemi oluşturun.
- Kaynak ve kesme işlemi yapılan yerlerde uygun bir duman emme sistemi kullanın. Gerekliyse tüm atölyede biriken duman ve gazları dışarıya atabilecek bir sistem kurun. Deşarj esnasında çevreyi kirletmemek için uygun bir filtrasyon sistemi kullanın.
- Dar ve kapalı alanlarda çalışıyoysanız veya kurşun, berilyum, kadmiyum, çinko, kaplı ya da boyali malzemelerin kaynağını yapıyoysanız, yukarıdaki önlemlere ilave olarak temiz hava sağlayan maskeler kullanın.
- Gaz tüpleri ayrı bir bölgede gruplandırılmışsa buraların iyi havalandmasını sağlayın, gaz tüpleri kullanımda dejiklen ana vanalarını kapalı tutun, gaz kaçaklarına dikkat edin.
- Argon gibi koruyucu gazlar havadan daha yoğundur ve kapalı alanlarda kullanıldıkları takdirde havanın yerine solunabilirler. Bu da sağlığınıza için tehlikelidir.
- Kaynak işlemlerini yağlama veya boyama işlemlerinde açığa çıkan klorlu hidrokarbon buharlarının olduğu ortamlarda yapmayın.

**Ark İşiği****Gözlerinize ve Cildinize****Zarar Verebilir**

- Gözlerinizi ve yüzünüzü korumak için uygun koruyucu maske ile ona uygun (EN 379'a göre 4 ila 13) cam filtre kullanın.

- Vücutunuzun diğer çiplak kalan yerlerini (kollar, boyun, kulaklar, vb) uygun koruyucu giysilerle bu işnlardan koruyun.

- Çevrenizdeki kişilerin ark işnlarından ve sıcak metallerden zarar görmemeleri için çalışma alanınızı göz hizasından yüksek, aleve dayanıklı paravanlarla çevirin ve uyarı levhaları asın.

- Buz tutmuş boruların istilimesinde kullanılmaz. Kaynak makinesiyle yapılan bu işlem tesisatinizda patlama, yanım veya hasara neden olur.

**Kivilcimler ve Sıçrayan****Parçalar Gözlerinizi****Yaralayabilir**

- Kaynak yapmak, yüzey taşlamak, fırçalamak gibi işlemler kivilcimlara ve metal parçacıklarının sıçramasına neden olur. Oluşabilecek yaralanmaları önlemek için kaynak maskesinin altına, kenar korumalarıyla olan onaylanmış koruyucu iş gözlükleri takın.

**Sıcak Parçalar Ağır****Yanıklara Neden Olabilir**

- Sıcak parçalara çiplak el ile dokunmayın.

- Makinenin parçaları üzerinde çalışmadan önce soğumaları için gerekli sürenin geçmesini bekleyin.

- Sıcak parçaları tutmanız gerektiğinde, uygun alet, ıslı izolasyonu yüksek kaynak eldiveni ve yanmaz giysiler kullanın.

**Gürültü, Duyma****Yeteneğinize****Zarar Verebilir**

- Bazi ekipman ve işlemlerin oluşturacağı gürültü, duyma yeteneğinize zarar verebilir.

- Eğer gürültü seviyesi yüksek ise onaylanmış kulak koruyucularını takın.

**Kaynak Teli Yaralanmaları****Yol Açıbilir**

- Kaynak teli sargasını boşaltırken torcu vücudun herhangi bir bölümüne, diğer kişilere ya da herhangi bir metale doğru tutmayın.
- Kaynak telini makaradan elle açarken -özellikle ince çaplarda - tel, bir yay gibi elinizden fırlayabilir, size veya çevrenizdeki diğer kişilere zarar verebilir, bu işlemi yaparken özellikle gözlerinizi ve yüzünü koruyun.

**Kaynak İşlemi  
Yangınlara ve  
Patlamalarla Yol Açıbilir**

- Yanıcı maddelere yakın yerlerde kesinlikle kaynak yapmayın. Yangın çıkabilir veya patlamalar olabilir.
- Kaynak işlemeye başladan önce bu maddeleri ortamdan uzaklaştırın veya yanmalarını ve harımlarını önlemek için koruyucu örtülerle üstlerini örtün.
- Bu alanlarda ulusal ve uluslararası özel kurallar geçerlidir.



- Tamamen kapalı tüpler ya da borulara kaynak ve kesme işlemi uygulamayın.
- Tüp ve kapalı konteynerlere kaynak yapmadan önce bunları açın, tamamıyla boşaltıp, havalandırıp temizleyin.
- Bu tip yerlerde yapacağınız kaynak işlemlerinde mümkün olan en büyük dikkati gösterin.
- İçinde daha önce, patlama, yangın ya da diğer tepkimelere neden olabilecek maddeler bulunan tüp ve borulara boş dahi olsalar kaynak yapmayın.
- Kaynak ekipmanları isnınırlar. Bu nedenle kolay yanabilecek veya hasar görebilecek yüzeylerin üzerine yerleştirimeyin!



- Kaynak kuvuçları yanına sebep olabilir. Bu nedenle yanın söndürücü tüp, su, kum gibi malzemeleri kolay ulaşabileceğiniz yerlerde bulundurun.
- Yanıcı, patlayıcı ve basıncı gaz devreleri üzerinde geri tepme ventilleri, gaz regülatörleri ve vanalarını kullanın. Bunların periyodik kontrollerinin yapılp sağlıklı çalışmasına dikkat edin.

**Makineler ve Aparatlar  
Yetkisiz Kişiler Tarafından  
Bakım Yapılması  
Yaralanmaları  
Neden Olabilir**

- Elektrikli cihazlar yetkisiz kişilere tamir ettilirmemelidir. Burada yapılabilecek hatalar kullanımda ciddi yaralanmalarla veya ölümlere neden olabilir.
- Gaz devresi elementleri basınç altında çalışmaktadır; yetkisiz kişiler tarafından verilen servisler sonucunda patlamalar olabilir, kullanıcılar ciddi şekilde yaralanabilir.
- Makinanın ve yan birimlerinin her yıl en az bir kez teknik bakımının yaptırılması tavsiye edilir.

**Küçük hacimli  
Kapalı Alanlarda Kaynak**

- Küçük hacimli ve kapalı alanlarda mutlaka bir başka kişi eşliğinde kaynak ve kesme işlemlerini yapın.
- Mممكىن olduğu kadar bu tarz kapalı yerlerde kaynak ve kesme işlemleri yapmaktan kaçının.

**Taşıma Esnasında  
Gerekli Önlemlerin  
Alınmaması  
Kazalara Neden Olabilir**

- Makinenin taşınmasında gerekli tüm önlemleri alınır. Taşıma yapılacak alanlar, taşımada kullanılacak parçalar ile taşımayı gerçekleştirecek kişinin fiziki koşulları ve sağlığı taşıma işlemine uygun olmalıdır.
- Bazı makineler son derece ağırdır, bu nedenle yerleri değiştirirken gerekli çevresel güvenlik önlemlerinin alındığından emin olunmalıdır.
- Kaynak makineleri bir platform üzerinden kullanılacaksa, bu platformun uygun yük taşıma sınırlarına sahip olduğu kontrol edilmelidir.
- Bir vasıtaya yardımı ile ( taşıma arabası, forklift vb.) taşınacak ise vasitanın ve makineyi vasıtaya bağlayan bağlantı noktalarının( taşıma askısı,kayıf, civata, somun, tekerlek vb.) sağlamlığınından emin olunuz.
- Elle taşıma işlemi gerçekleştirilecek ise Makine aparatlarının( taşıma askısı, kayış vb.) ve bağlantılarının sağlamlığından emin olunuz.

- Gerekli taşıma koşullarının sağlanması için Uluslararası Çalışma Örgütünün taşıma ağırlığı ile ilgili kurallarını ve ülkenizde var olan taşıma yönetmeliklerini göz önünde bulundurunuz.
- Güç kaynağının yerini değiştirirken her zaman tutamakları veya taşıma halkalarını kullanın. Asla torç, kablo veya hortumlardan çekmeyin. Gaz tüplerini mutlaka ayrı taşıyın.
- Kaynak ve kesme ekipmanlarını taşımadan önce tüm ara bağlantılarını söküp, ayrı ayrı olmak üzere, küçük olanları saplarından, büyükleri ise taşıma halkalarından ya da forklift gibi uygun kaldırma ekipmanları kullanarak kaldırın ve taşıyın.

**Düşen Parçalar Yarananmalara  
Sebepli Olabilir**



**Güç kaynağının ya da diğer ekipmanların doğru konumlandırılmaması, kişilerde ciddi yarananmalara ve diğer nesnelerde maddi hasara neden olabilir.**

- Makinenizi düşmeyecek ve devrilmeyecek şekilde maksimum 10° eğime sahip zemin ve platformlara yerleştirin. Malzeme akşına engel olmayacağı, kablo ve hortumlara takılma riskinin oluşmayacağı, hareketsiz; ancak geniş, rahat havalandırılabilen, tozsuz alanları tercih edin. Gaz tüplerinin devrilmemesi için tüpe uygun gaz platformu bulunan makinelerde platformun üzerine, sabit kullanımlarda ise devrilmeyecek şekilde zincirle duvara sabitleyin.
- Operatörlerin makine üzerindeki ayarlarla ve bağlantılarla kolayca ulaşmasını sağlayın.

**Aşırı Kullanım Makinenin**

- Çalışma çevrimi oranlarına göre makinenin soğumasına müsaade edin.

**Aşırı Isınmasına**

- Akımı veya çalışma çevrimi oranını tekrar kaynağı başlamadan önce düşürün.

**Neden Oetur**



- Makinenin havalandırma girişlerinin öünü kapamayın.

- Makinenin havalandırma girişlerine, üretici onayı olmadan filtre koymayın.

**Ark Kaynağı**

- Bu cihaz TS EN 55011 standardına göre EMC testlerinde grup 2, class A dir.

**Elektromanyetik Parazitlere**

- Bu class A cihaz elektriksel gücün alçak gerilim şebekeden sağlandığı meskin mahallede kullanım amacıyla üretilmemiştir. Bu gibi yerlerde iletlenen ve yayılan radyo frekans parazitlerinden dolayı elektromanyetik uyumluluğu sağlamakla ilgili muhafemel zorluklar olabilir.

**Neden Oetur**



- Bu cihaz IEC 61000 - 3 - 12 uyumlu değildir. Evlerde kullanılan alçak gerilim şebekesine bağlanmak istenmesi durumunda, elektrik bağlantısını yapacak tesisatının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.

- Çalışma bölgesinin elektromanyetik uyumluluğu (EMC) uygun olduğundan emin olun. Kaynak veya kesme işlemi esnasında olusabilecek elektromanyetik parazitler, elektronik cihazlarınızda ve şebekeinizde istenmeyen etkilere neden olabilir. İşlem sırasında olusabilecek bu parazitlerin neden olabileceği etkiler kullanıcının sorumluluğu altındadır.
- Eğer herhangi bir parazit oluşuyorsa, uygunluğu sağlamak için; kısa kablo kullanımı, kormalı (zırhlı) kablo kullanımı, kaynak makinesinin başka bir yere taşınması, kabloların etkilenen cihaz ve/veya bölgeden uzaklaştırılması, filtre kullanımı veya çalışma alanının EMC açısından korunmaya alınması gibi ekstra önlemler alınabilir.
- Olası EMC hasarlarını engellemek için kaynak işlemlerini hassas elektronik cihazlarınızdan mümkün olduğunda uzakta (100m) gerçekleştirin.
- Kaynak kesme makinenizin kullanma kılavuzuna uygun şekilde kurulup yerleştirildiğinden emin olun.

**Çalışma Alanının  
Elektromanyetik Uygunluğunun  
Değerlendirilmesi**



**IEC 60974-9 madde 5.2'ye göre;**

Kaynak ve Kesme donanımı tesis etmeden önce, işletme yetkilisi ve/veya kullanıcı, çevredeki olası elektromanyetik

parazitler hakkında bir inceleme yapmalıdır. Aşağıda belirtilen haller göz önünde bulundurulmalıdır;

- a) Kaynak makinesi ve donanımının üstünde, altında ve yanındaki diğer besleme kabloları, kontrol kabloları, sinyal ve telefon kabloları,
- b) Radyo ve televizyon vericileri ve alıcıları,
- c) Bilgisayar ve diğer kontrol donanımı,
- d) Kritik güvenlik donanımı, örneğin endüstriyel donanımın korunması,
- e) Çevredeki insanların tıbbi aparatları, örneğin kalp pilleri ve işitme cihazları,
- f) Ölçme veya kalibrasyon için kullanılan donanım,
- g) Ortamındaki diğer donanımın bağılılığı. Kullanıcı, çevrede kullanılmakta olan diğer donanımın uyumlu olmasını sağlamalıdır. Bu, ilave koruma önlemleri gerektirebilir,
- h) Kaynak işleminin ya da diğer faaliyetlerin gün içindeki gerçekleştirileceği zaman, göz önüne alınarak çevrenin büyütülüğü, binanın yapısına ve binada yapılmakta olan diğer faaliyetlere göre inceleme alanı sınırları genişletilebilir.

Alanın değerlendirilmesine ek olarak cihaz kurulumlarının değerlendirilmesi de bozucu etkinin çözümü için gerekli olabilir.

Gerek görülmeyeceğinde, yerinde ölçümler azaltıcı önlemlerin verimliliklerini onaylamak için de kullanılabilir.

(Kaynak: IEC 60974-9).

**Parazit Azaltma  
Yöntemleri**



- Cihaz tavsiye edilen şekilde ve yetkili bir kişi tarafından elektrik şebekesine bağlanmalıdır. Eğer parazit olursa şebekenin filtrelenmesi gibi ek önlemler uygulanabilir. Sabit montajlı ark kaynağı ekipmanının beslemesi metal bir boru içerisinde veya esdeger ekranlı bir kablo ile yapılmalıdır. Ekran ile güç kaynağının mahfazası bağlı olmalı ve bu iki yapı arasında iyi bir elektriksel temas sağlanmalıdır.
- Cihazın tavsiye edilen rutin bakımları yapılmalıdır. Cihaz kullanıldayken, kaportaın tüm kapakları kapalı ve/veya kilitli olmalıdır. Cihaz üzerinde üreticinin yazılı onayı olmadan standart ayarları dışında herhangi bir değişiklik, modifikasyon kesinlikle yapılamaz. Aksi durumda oluşabilecek her türlü sonuçtan kullanıcı sorumludur.
- Kaynak kabloları mümkün olduğunda kısa tutulmalıdır. Çalışma alanının zemininden yanyana olacak şekilde ilerlemelidirler. Kaynak kabloları hiçbir şekilde sarılmamalıdır.
- Kaynak esnasında makinede manetik alan oluşmaktadır. Bu durum makinenin metal parçaları kendi üzerine çekmeye sebebiyet verebilir. Bu çekimi engellemek adına metal malzemelerin güvenli mesafede veya sabitlenmiş olduğundan emin olunuz. Operatör, bütün bu birbirine bağlanmış metal malzemelerden yarılılmalıdır.
- İş parçasının elektriksel güvenlik amacıyla veya boyutu ve pozisyonu sebebiyle topraka bağlanmadığı durumlarda (örneğin gemi gövdesi veya çelik konstrüksiyon imalatı) iş parçası ile toprak arasında yapılacak bir bağlantı bazı durumlarda emisyonları düşürebilir. İş parçasının topraklanmasının kullanıcıların yaralanmasına veya ortamındaki diğer elektrikli ekipmanların ariza yapmasına neden olabileceği unutulmamalıdır. Gerekli hallerde iş parçası ile toprak bağlantısı doğrudan bağlantı şeklinde yapılabilir fakat doğrudan bağlantıya izin verilemeyecek bazı ürkelerde bağlantı yerel düzenevine ve yönetmeliklere uygun olarak, uygun kapasite elemanları kullanılarak oluşturulabilir.
- Çalışma alanındaki diğer cihazların ve kabloların ekranlanması ve muhafazası bozucu etkilerin önüne geçilmesini sağlayabilir. Kaynak bölgesinin tamamının ekranlanması bazı özel uygulamalar için değerlendirilebilir.

- Ark Kaynağı Elektronmanyetik Alana (EMF) Neden Olabilir**
- 
- Herhangi bir iletken üzerinden geçen elektrik akımı, bölgesel elektrik ve manyetik alanlar (EMF) oluşturur.
- Bütün kaynakçalar, kaynak devresinden gelen EMF'ye maruz kalmanın sebep olduğu riski en azı indirmek için aşağıdaki prosedürleri uygulamalıdır;
- Manyetik alanı azaltmak adına kaynak kabloları bir araya getirilmeli, mümkün olduğunda birleştirici malzemelerle (bant,kablo bağı vb.) emniyet altına alınmalıdır.
  - Kaynakçının/calışanın gövdesi ve başı, kaynak makine ve kablolarından mümkün olduğunda uzakta tutulmalıdır,
  - Kaynak kabloları vücudun etrafına hiçbir şekilde sarılmamalıdır,
  - Vücut, kaynak kablolarının arasında kalmamalıdır. Kaynak kablolarının her ikisi yan yana olmak üzere vücudun uzağında tutulmalıdır,
  - Dönüş kablosu iş parçasına, kaynak yapılan bölgeye mümkün olduğunda yakın bir şekilde bağlanmalıdır,
  - Kaynak güç ünitesine yaslanmamalı, üzerine oturmamalı ve çok yakınında çalışılmamalıdır,
  - Kaynak teli besleme birimi veya kaynak güç ünitesini taşıırken kaynak yapılmamalıdır.
- EMF ayrıca, kalp pilleri gibi tıbbi implantların (vücut içine yerleştirilen madde) çalışmasını bozabilir. Tıbbi implantları olan kişiler için koruyucu önlemler alınmalıdır. Örneğin, yoldan geçenler için erişim sınırlaması koyulabilir veya kaynakçalar için bireysel risk değerlendirmeleri yapılabilir. Bir tıp uzmanı tarafından, tıbbi implantları olan kullanıcılar için risk değerlendirmesi yapılp, öneride bulunulmalıdır.
- 
- Koruma**
- 
- Makineyi yağmura maruz bırakmayın, üzerine su sıçramasına veya basınçlı buhar gelmesine engel olun.
- 
- Enerji Verimliliği**
- 
- Yapacağınız kaynağa uygun kaynak yöntemi ve kaynak makinesi tercihinde bulunun.
  - Kaynak yapacağınız malzemeye ve kalınlığına uygun kaynak akımı ve/veya gerilimi seçin.
  - Kaynak yapmadan uzun süre beklenilecekle, fan makineyi soğuttuktan sonra makineyi kapatın. Akıllı fan kontrolü olan makinalarımız (ürünlerimiz) kendi kendine duracaktır.
- 
- Atık Prosedürü**
- 
- Bu cihaz evsel atık değildir. Avrupa Birliği direktifi ile ulusal yasa çerçevesinde geri dönüşüme yönlendirilmek zorundadır.
  - Kullanılmış makinenizin atık yönetimi hakkında sizincdn ve yetkili kişilerden bilgi edinin.

## TEKNİK BİLGİLER

TR

### 1.1 Genel Açıklamalar

Monotig 160i Basic, invertör tipi, kolay taşınabilir, monofaze DCTIG ve Örtülü Elektrod kaynak makinesidir. Makine monofaz olmasına rağmen inverter teknolojisi sayesinde kullanıcıya stabil bir ark kaynağı sağlar. Her tür ince metalin TIG kaynağını Lift-TIG yöntemi ile yapar. HF ile TIG kaynağı mevcut değildir.

Antistatik özelliğinin sayesinde elektrodon yüzeye yapışması durumunda akımı keserek elektrodon yüzeyden daha rahat ayrılması sağlanmış olur.


Makine ayrıca 3.25 mm ye kadar Rutil ve Bazik elektrodu yakmak için tasarlanmıştır.

Monotig 160i Basic, 185 V ile 250 V arasında 50/60 Hz şebekede geriliminden, böylece jeneratörlerle çalışır.

Ayrıca, uzun ( $<25$  m) kaynak kablolarıyla da kullanılabilir.

Makine fan soğutmalıdır ve aşırı ısınmaya karşı termik korumalıdır.

### 1.2 Makine Bileşenleri

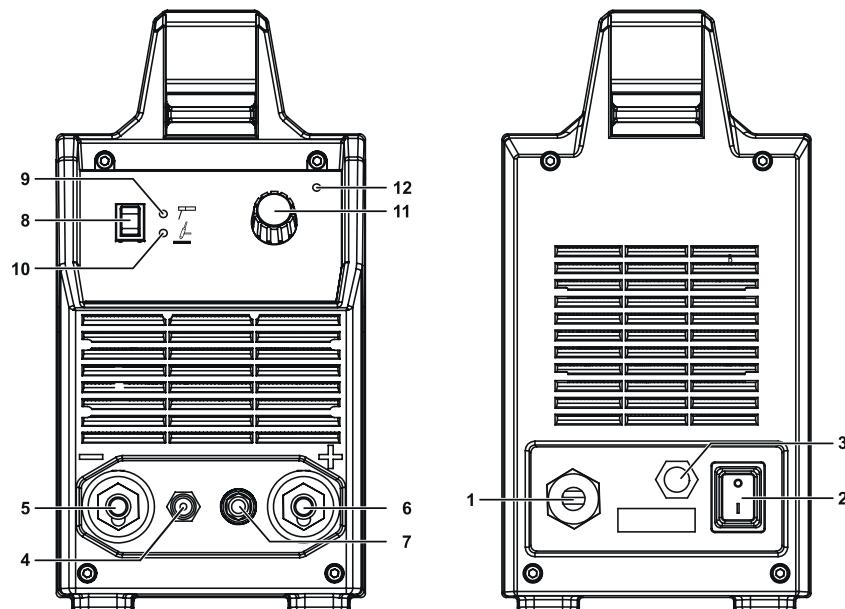

Şekil 1: Monotig 160i Basic


- |                                       |                                |
|---------------------------------------|--------------------------------|
| 1-Besleme Kablosu Girişü              | 7-Tetik Kontrol Soketi         |
| 2-Açma / Kapama Düğmesi               | 8-Kaynak Modu Seçim Düğmesi    |
| 3-Gaz Girişü                          | 9-Örtülü Elektrod Kaynağı LEDi |
| 4-TIG Kaynağı Soketi (-)              | 10-TIG Kaynağı LEDi            |
| 5-Kaynak ve Toprak Kablosu Soketi (-) | 11-Akim Ayar Düğmesi           |
| 6-Kaynak ve Toprak Kablosu Soketi (+) | 12-Termik Arıza LEDi           |

### 1.3 Ürün Etiketi

<b>MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.</b> <b>Organize Sanayi Bölgesi 5. Kısımlı Manisa-TÜRKİYE</b>			
<b>MONOTIG 160i BASIC</b>		Seri No:	
1~		EN 60974-1 / EN 60974-10 Class A	
		10A / 10.4V - 160A / 16.4V	
X	20%	60%	100%
I <sub>2</sub>	160A	92A	72A
U <sub>2</sub>	16.4V	13.7V	12.9V
I <sub>1</sub>	22.4A	11.2A	8.4A
S <sub>1</sub>	5.2kVA	2.6kVA	1.9kVA
$I_{1\max} = 22.4A$		$I_{1\text{eff}} = 10A$	
		10A / 20.4V - 160A / 26.4V	
X	20%	60%	100%
I <sub>2</sub>	160A	92A	72A
U <sub>2</sub>	26.4V	23.7V	22.9A
I <sub>1</sub>	34A	17.5A	13.5A
S <sub>1</sub>	7.8kVA	4kVA	3.1kVA
1~50-60Hz	U <sub>1</sub> =230V	$I_{1\max} = 34A$	$I_{1\text{eff}} = 15.2A$
	IP23S		

	Tek Fazlı Transformatör Doğrultucu
	TIG Kaynağı
	Örtülü Elektrod Kaynağı
	Doğru Akım
	Düsey Karakteristik
	Şebeke Girişi-1 Fazlı Alternatif Akım
	Tehlikeli Ortamlarda Çalışmaya Uygun
X	Çalışma Çevrimi
U <sub>0</sub>	Böşta Çalışma Gerilimi
U <sub>1</sub>	Şebeke Gerilimi ve Frekansı
U <sub>2</sub>	Anma Kaynak Gerilimi
I <sub>1</sub>	Şebekeden Çekilen Anma Akımı
I <sub>2</sub>	Anma Kaynak Akımı
IP23S	Koruma Sınıfı
S <sub>1</sub>	Şebekeden Çekilen Güç

Çalışma Çevrimi  
Sıcaklık (°C)

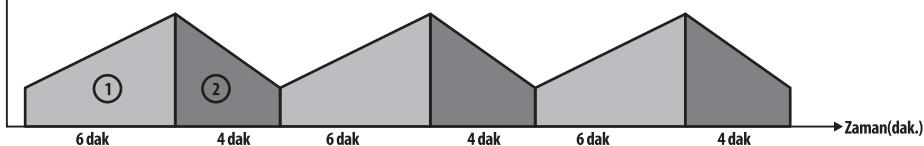

EN 60974-1 standardında da tanımladığı üzere çalışma çevrim oranı 10 dakikalık bir zaman periyodu içerir. Örnek olarak %60'da 250A olarak belirtilen bir makinede 250A'de çalışılmak isteniyorsa, makine 10 dakikalık zaman periyodunun ilk 6 dakikasında hiç durmadan kaynak yapabilir (1 bölgesi). Ancak bunu takip eden 4 dakika makine soğuması için boşta bekletilmelidir (2 bölgesi).

## 1.4 Teknik Özellikler

TEKNİK ÖZELLİKLER	BİRİM	DEĞER
Şebeke Gerilimi (1 faz - 50-60 Hz)	V	230
Şebekeden Çekilen Güç - TIG (%20)	KVA	5,2
Şebekeden Çekilen Güç - Örtülü Elektrod (%20)	KVA	7,8
Şebekeden Çekilen Akım - TIG (%20)	A	22,4
Şebekeden Çekilen Akım - Örtülü Elektrod (%20)	A	34
Güç Faktörü		0,66
Boşta Çalışma Gerilimi		65
Kaynak Akım Ayar Sahası - TIG	VDC	10-160
Kaynak Akım Ayar Sahası - Örtülü Elektrod	ADC	10-160
Anma Kaynak Akımı - TIG (%20)	ADC	160
Anma Kaynak Akımı - Örtülü Elektrod (%20)	ADC	160
Koruma Sınıfı		IP23S
Soğutma Sistemi		Hava
Boyutlar (UxGxY)	mm	450x160x312
Ağırlık	kg	9,5
Standart ve Onaylar		CE, EN60974-1, EN60974-10

## 1.5 Aksesuarlar

STANDART AKSESUARLAR	ADET	ÜRÜN KODU
Topraklama Pensesi ve Kablosu	1	7905201603
Elektrod Pensesi ve Kablosu	1	7906201603
Gaz Hortumu	1	7907000002
Torç (Hava Soğutmalı 4m)	1	7011100004
OPSİYONEL AKSESUARLAR	ADET	ÜRÜN KODU
Su Soğutma Ünitesi (CSP 40)	1	7910005200
Gaz Regülatörü	1	7020001004
Ayak Pedali (On/Off)	1	7910000130
Taşıma Arabası	1	7910000100

## KURULUM BİLGİLERİ

### 2.1 Teslim Alırken Dikkat Edilecek Hususlar

TR

Satin aldığınız kaynak makinesini forkliftle taşıma kurallarına uyacak şekilde ambalajından çıkartmak için önce şirinki yırtın, ardından çemberi kesin ve makineyi forkliftle taşıma kurallarına uyacak şekilde kaldırarak paletin üzerinden indirin. Siparişinizi eksiksiz teslim olduğunuzdan emin olunuz. Herhangi bir malzemenin eksik veya hasarlı olması halinde derhal aldiğiniz yer ile temasla geçin.

Standart palet şunları içermektedir:

- Ana makine ve ona bağlı şebeke kablosu
- Aski kayışı
- TIG torcu
- Garanti belgesi
- Topraklama pensesi ve kablosu
- Kullanım kılavuzu

Hasarlı teslimat halinde tutanak tutun, hasarı resmini çekin, ırsaliyenin fotokopisi ile birlikte nakliyeci firmaya bildirin. Sorunun devam etmesi halinde müşteri hizmetleri ile irtibata geçin.

#### Cihaz üzerindeki simboller ve anlamları;



Kaynak yapma işlemi tehlike içermektedir. Uygun çalışma koşulları sağlanmalı ve gerekli önlemler alınmalıdır. Uzman kişiler makinede sorumlu olup, gerekli donanımları sağlamalıdır. İlgili olmayan kişiler kaynak sahasından uzak tutulmalıdır.



Bu cihaz IEC 61000-3-12 uyumlu değildir. Evlerde kullanılan açık gerilim şebekesine bağlanmak istenmemi durumunda, elektrik bağlantı-sını yapacak tesisatının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.



Cihaz üzerinde ve kullanım kılavuzunda bulunan güvenlik sembollerine ve uyarı notlarına dikkat edilmeli, etiketleri sökülmemelidir.



İzgaralar havalandırma amaçlıdır. Açıklıkların üzeri iyi bir soğutma sağlamak amacıyla örtülmemeli ve içeriye yabancı cisim sokulmamalıdır.

### 2.2 Kurulum ve Çalışma Tavsiyeleri

- Makineyi taşıma esnasında gerekli önlemler alınmalıdır. Makineyi gaz tüpüyle birlikte kaldırımayın. Güç kaynağını düşmeyeceği ve devrilmeyeceği sert, düzgün ve eğimsiz bir zemine yerleştirin.
- Daha iyi performans için, makineyi çevresindeki nesnelerden en az 30 cm uzaga yerleştirin. Makine çevresindeki aşırı ısınma, toz ve neme dikkat edin. Makineyi direk güneş ışığı altında çalıştırmayın. Ortam sıcaklığının 40°C yi aştığı durumlarda, makineyi daha düşük akımda ya da daha düşük çevrim oranında çalıştırın.
- Dış mekanlarda rüzgar ve yağmur varken kaynak yapmaktan kaçın. Bu tür durumlarda kaynak yapmak zorunluysa, kaynak bölgesini ve kaynak makinesini perde ve tenteye koruyun.
- Makineyi konumlandırırken duvar, perde, pano gibi materyallerin makinenin kontrol ve bağlantılarına kolay erişimi engellemediyinden emin olun.
- İçerde kaynak yapıyorsanız, uygun bir duman emme sistemi kullanın. Kapalı mekanlarda kaynak dumanı ve gazi soluma riski varsa, solunum aparatları kullanın.
- Ürün etiketinde belirtilen çalışma çevrimi oranlarına uyun. Çalışma çevrimi oranlarını sıkılıkla aşmak, makineye hasar verebilir ve bu durum garantiyi geçersiz kılar.
- Sisteminiye uygun sigortayı kullanın.
- Toprak kablosunun kaynak bölgesinin olabildiğince yakınına sıkıca bağlayın. Kaynak akımının kaynak kabloları dışındaki elemanlardan,örneğin makinenin kendi, gaz tüpü, zincir, rulman, üzerinden geçmesine izin vermeyin.
- Gaz tüpü makinenin üzerine yerleştirildiğinde, derhal zinciri bağlayarak gaz tüpünü sabitleyin. Eğer gaz tüpünü makinenin üzerine yerleştirmeyeceksiniz, tüp zincirle duvara sabitleyin.
- Makinenin arkasında yer alan elektrik prizi CO<sub>2</sub> ısıtıcı içindir. CO<sub>2</sub> prizine CO<sub>2</sub> ısıtıcı dışında bir cihazı kesinlikle bağlamayın!


## 2.3 TIG Kaynağı

### 2.3.1 Makineyi Şebekeye Bağlayın ve Çalıştırın



Makineyi şebekeye bağlamadan önce şebeke gerilimini kontrol edin [230 VAC].


- Açma/kapama düğmesini kapalı "0" konuma getirip makinenin fışını prize takın.
- Açma/kapama düğmesi (2) ile makineyi çalıştırın. Açıma/kapama düğmesinin ile kontrol panelindeki göstergeler ve LEDlerin yanlığını ve soğutma fanının çalıştığını tespit edin ve soğutma fanının sesini duyduğundan emin olun.

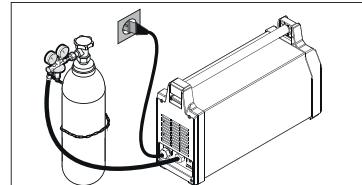

**Şekil 2: Gaz ve Şebeke Bağlantıları**

### 2.3.2 Gaz Bağlantıları

- Argon gaz tüpünü (13) zincirle duvara sabitleyin. Emniyetle çalışmak ve iyi sonuçlar elde etmek için standartlara uygun bir regülatör (14) kullanın.
- Gaz tüpü vanasını (15) bir süre açık tutarak, olası tortu ve partiküllerin dışarı atılmasını sağlayın.
- Gaz regülatörünü (14) gaz tüpüne bağlayın, gaz tüpünün gaz çıkışındaki vida dışı ile regülatörün somununun örtüştüğünden emin olun.
- Tüp hortumunun (16) bir ucunu gaz regülatörüne (14), diğer ucunu makinenin arkasındaki gaz girişine (3) bağlayıp gaz tüpü vanasını (15) açın.

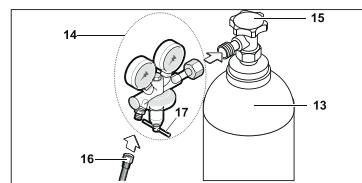


**Şekil 3: Gaz Tüpü - Regülatör - Hortum Bağlantısı**

### 2.3.3 Torç Bağlantıları

- TIG torcunun somununu (17) TIG kaynak soketine (4) vidalayın.
- Torç konnektörünü (19) tetik kontrol soketine (7) bağlayın.

### 2.3.4 Topraklama Pensesi Bağlantıları

- Topraklama pensesi kablosunun fışını (20) artı kutuplu sokete (6) sokup sağa çevirerek iyice sıkın.
- Kaynak kalitesini artırmak için, topraklama pensesini (21), kaynak yapılacak bölgeye olabildiğince yakın bir yerde, iş parçasına sıkıca bağlayın.

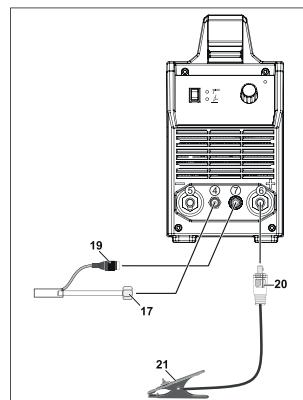

**Şekil 4: Kaynak Bağlantıları**


### 2.3.5 Kaynak Ayarları

- Kaynak modu seçim düğmesini (8) TIG kaynağı konumuna getirin.
- Akım ayar düğmesi (11) ile kaynak akımını ayarlayın.
- Basınç ayar vanası (15) ile gaz debisini ayarlayın.
- Makine TIG kaynağına hazırlır.

Elektrod Çapı (mm)	Nozul Çapı (mm)	Kaynak Akımı (ADC)	Gaz Debisi (lt/dak)
1.0	6.3	30 - 70	6 - 8
1.6	9.5	30 - 150	6 - 8

### 2.3.6 Tungsten Elektroodu Değiştirme

- Seramik gaz nozulu (26) ve tungsten elektrod (22) çalışma akımına ve iş parçasının şekline göre seçilmiştir. Buna bağlı olarak, kısaç (24) ve kısaç tutucunun (25) çapları tungsten elektrodun çapıyla örtüşmelidir.
- Sıkıştırma başlığını (23) çıkartın.
- Mevcut elektrod (22), elektrod kıskaçından (24) çıkartıp yeni tungsten elektrod (22) yerleştirin.
- Elektrod kıskaçını (24) torca takın.
- Sıkıştırma başlığını (23) iyice sıkıştırın.

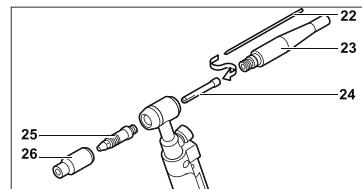

Şekil 5: Tungsten Elektroodu Değiştirme

### 2.4 Örtülü Elektrod Kaynağı


- 2.3.1 deki basamakları takip ederek makineyi çalıştırın.
- Elektrod pensesi kablosunun fisini ve topraklama pensesi kablosunun fisini, kullanılacak elektroda ve elektrod üreticisinin tavsiye ettiği kutuplara göre kaynak ve toprak kablosu soketlerine (5-6) bağlayın.
- Kaynak kalitesini artırmak için, topraklama pensesini kaynak yapılacak bölgeye olabildiğince yakın bir yerde, iş parçasına sıkıca bağlayın.
- Kaynak akımını ayarlayın. Makine kaynağa hazırlır.
- Aşağıdaki tablo alaşimsız çeliklerin amper ayarı için referans olara verilmiştir. Lütfen elektrod üreticisinin tavsiyelerine uyunuz.

Çap	Rutil	Bazik	Selülozik
2.0	40-60 A	-	-
2.5	60-90 A	60-90 A	60-100 A
3.25	100-140 A	100-130 A	70-130 A
4.0	140-180 A	140-180 A	120-170 A

## BAKIM VE ARIZA BİLGİLERİ

TR


- Geçerli güvenlik kurallarına bakım onarım işlemleri sırasında mutlaka okuyunuz.
- Tamir için makinenin herhangi bir civatasını sökümeden önce, makinenin elektrik fışını şebekeden ayıriz ve kondan-satörlerin boşalması için 10 saniye bekleyiniz.

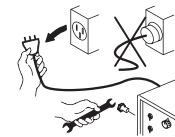

### 3.1. Bakım


#### 3 Ayda Bir

- Cihaz üzerindeki uyarı etiketlerini sökmeyiniz. Yıpranmış / yırtılmış etiketleri yenisi ile değiştiriniz. Etiketleri yetkili servisten temin edebilirsiniz.
- Penselerin ve Kablolarınızın kontolünü yapınız. Parçaların bağlantılara ve sağlamlığına dikkat ediniz. Hasar görmüş / arızalı parçaları yenisi ile değiştiriniz. Kablolara ek / onarım kesinlikle yapmayınız.

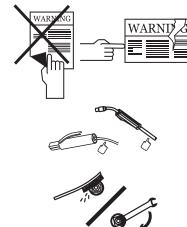


#### 6 Ayda Bir

- Civata, somun gibi birleştirici parçaları temizleyiniz ve sıkıştırınız.
- Elektrod pensesi ve toprak pensesi kablolarnı kontrol ediniz.
- Makinenin yan kapaklarını açarak düşük basınçlı kuru hava ile temizleyiniz. Elektronik parçalara yakın mesafeden basınçlı hava uygulamayınız.

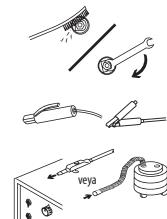

### 3.2 Periyodik Olmayan Bakım

- Tel Süreme Mekanizması temiz tutulmalı ve makara yüzeyleri kesinlikle yağlanmamalı.
- Her kaynak teli değişiminde mutlaka mekanizma üzerinde biriken kalıntıları kuru hava yardımıyla temizleyin.
- Torç üzerindeki sarf malzemeler düzenli olarak temizlenmeli. Eğer gerekiyorsa değiştirilmeli. Bu malzemelerin uzun süreli kullanılması için orjinal ürünler olmasına dikkat edin.

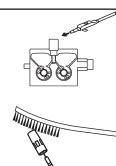

**NOT: Yukarıda belirtilen süreler, cihazınızda hiçbir sorunla karşılaşılmaması durumunda uygulanması gereken maksimum periyotlardır. Çalışma ortamınızın yoğunluğuna ve kirliliğine göre yukarıda belirtilen işlemleri daha sık aralıklarla tekrarlayabilirsiniz.**




**Asla kaynak makinesinin kapakları açıkken kaynak yapmayın.**

### 3.3 Hata Giderme

- Ön paneldeki termik arıza LEDi (12) yanarken makine kaynak yapmıyorsa, makine aşırı ısınmış ve termostat korumaya geçmiş olabilir. Havadaki yüksek sıcaklık ya da yüksek amper değerlerinde uzun süre kaynak yapmış olmanız aşırı ısınmanın muhtemel sebepleridir. Fanın makineyi soğutması için makineyi bir süre çalışır durumda bırakın. Makine soğuyup termik arıza LEDi (12) sondüğünde kaynağı devam edebilirsiniz.
- Fan çalışıyor ve açma/kapama düğmesinin (2) ışığı yanarken makine kaynak yapmıyorsa, makineyi kapatıp 1 dakika bekleyip makineyi tekrar çalıştırın ve kaynak yapmayı deneyin. Eğer hala kaynak yapmıyorsa, yetkili servise başvurun.


**EK 1 - YEDEK PARÇA LİSTESİ**


TR

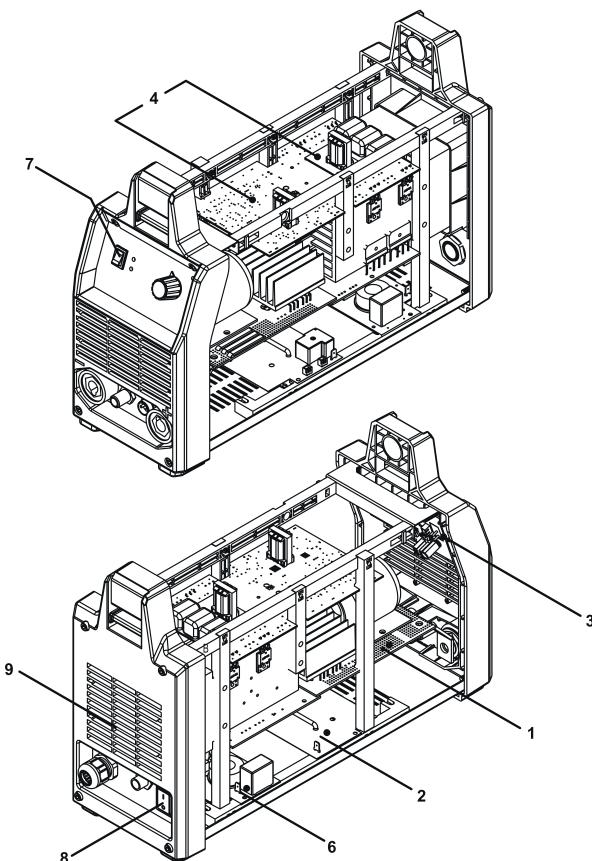

NO	TANIM	DEVRE ŞEMASINDA	MALZEME KODU
1	Elektronik Kart - Power	E203A PWR	K405000178
2	Elektronik Kart - Röle Kartı	E203A	K405000220
3	Elektronik Kart - Panel	E502A-4	K405000148
4	Elektronik Kart - Kontrol	TIG BASIC E213A CNT	K405000239
5	Elektronik Kart - Kondansatör	E203A PWR PFC	K405000222
6	Elektronik Kart - Filtre	E201B-FLT	K405000101
7	Kaynak Modu Seçim Düğmesi	Rocker Switch	A310100009
8	Açma Kapama Anahtarı	Power	A310100008
9	Fan	Fan	A250200026

 EK 2 - DEVRE ŞEMASI

TR

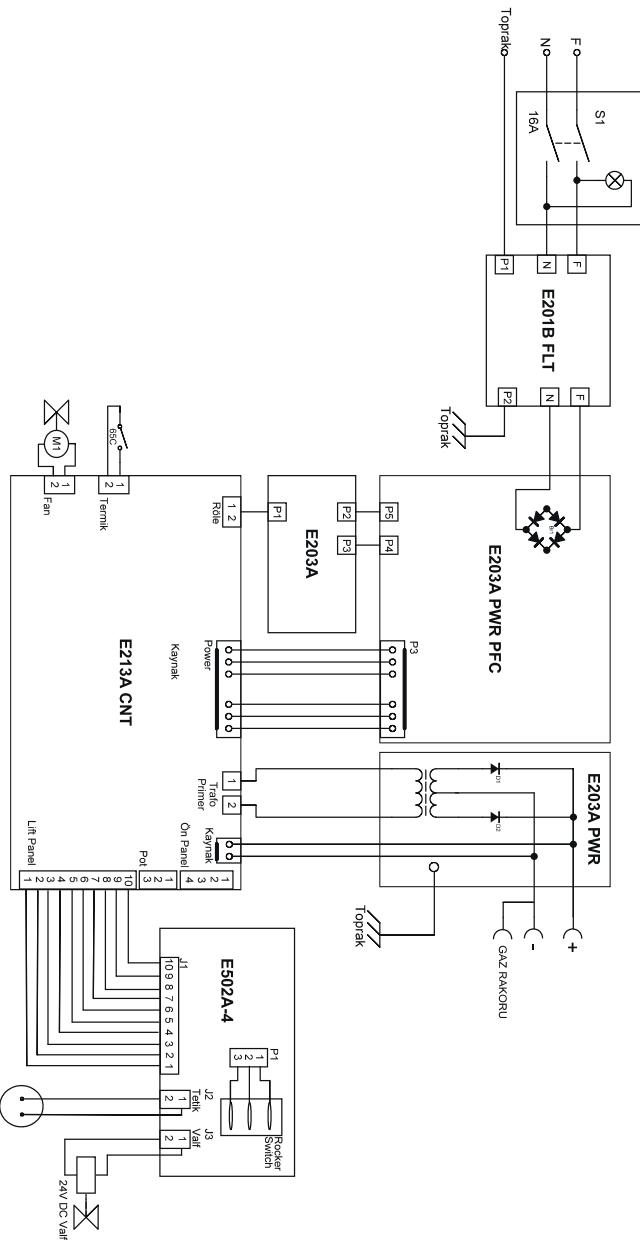

## YETKİLİ SERVİSLER

<b>ADANA</b>	<b>BİR ELEKTRİK BOBİNİ HİDROVAT</b> Yerleşim Mah. 04155 No: 001 Daire: 1001 Sınavlı Mah. 04155 No: 001 Daire: 1001 Tel: 0 322 49 10 70 - Mobil: 0 507 125 95 84	<b>DENİZLİ</b> 1. Sınavlı Mah. 150 Sok. No: 20 Tel: 0 328 626 7520	<b>İSTANBUL AVRUPA</b> Kaptan Teknik Makina Ayaklı Mah. 319 Sok. No: 174 Esenyurt Tel: 0 212 69 01 56	<b>MANİSA</b> GÜCÜ BOBİNİ Kemal Sınavlı Mah. 319 Sok. No: 6 Tel: 0 366 233 8800
<b>ADANA</b>	<b>TEŞER MAKİNA SANAYİ TİCARET</b> Yerleşim Mah. 45. Sok. 4 Nolu Çapı No: 21 Seyhan Tel: 0 322 429 23 92	<b>ÖZHES BOBİNİ</b> Sınavlı Mah. 1. Sınavlı Mah. 150 Sok. No: 15 Tel: 0 328 262 0666	<b>İSTANBUL AVRUPA</b> KAYER KAYNAK MAKİNA Ahmet Salihci Mah. Emniyet Mah. Sınavlı Mah. 176 Tel: 0 212 57 43 53	<b>MARDİN</b> GORAL ELEKTRONİK Ergani Mah. 12. Cad. No: 1/C Kontakte Tel: 0 628 313 18 45
<b>AİFYON</b>	<b>KOÇSABAN SANAYİ VET İBBİ GÜZLAR HİDROVAT</b> Güvençler Mah. 525. Sok. No: 0/1/A Tel: 0 321 21 12 22	<b>AKTS BOBİNİ</b> 1. Sınavlı Mah. 13. Bodrum Mah. Yenicebilek Tel: 0 321 69 01 59	<b>DİYARBAKIR</b> AHMET TEZCAN MAKİNA 1. Sınavlı Mah. 13. Bodrum Mah. Yenicebilek Tel: 0 321 69 01 59	<b>MERSİN</b> SANTEK STİ TEKNİK HİDROVAT Sarıyayla Mah. 24. Sayı: 20. Bülümü İşyeri Mah. 15/2 Tel: 0 242 234 1114
<b>AKŞARAY</b>	<b>AKŞARAY ORGANİTE MAKİNA BAKIM</b> Mahmut Mah. 035.8. ve 8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 331 380 75 30	<b>BİRDE MAKİNA</b> Kemal Mah. 761 Sok. No: 8 Tel: 0 380 123 83 53	<b>DÜZCE</b> ALTAŞ MAKİNA 4155 Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 323 476 15 02	<b>NİĞDE</b> MTS ELEKTRİK ELEKTRONİK Salihli Mah. 1. Sınavlı Mah. 150 Sok. No: 46/6 Tel: 0 388 311 2279
<b>ANKARA</b>	<b>TERİNİK ADİMLAR</b> Yıldız Mah. 145.3.5.8. ve 29. Birimhaneli Tel: 0 312 394 36 88	<b>ELAZİĞ</b> BÜLTÜN ELEKTRİK BOBİNİ Sınavlı Mah. 10. Sok. No: 12 Tel: 0 322 226 67 79	<b>İZMİR</b> BEREST MAKİNE VE SAN. ÜRÜN TEHS. VETİC. A.Ş. 6172 Sok. No: 172 394 İşyeri Beyoğlu Tel: 0 232 457 52 36	<b>ORDU</b> YESTİL MAKİNA HİDROVAT Kapıda Mah. 5. Sayı: 17. Sok. No: 15/4 Tel: 0 621 233 1269
<b>ANTALYA</b>	<b>SÖNERMAİNİNE</b> Yasaklı Mah. 565. Gazi Mah. 117/7A Tel: 0 242 36 20 25	<b>ERZİNCAN</b> BANDÜRCÜ ELEKTRİK MAKİNA K.8.9.9.9. Mah. Sümerhane Cad. No: 18/4	<b>İZMİR</b> NURİTTİN TANIM MAKİNA SAN. LTD. ŞTİ. 5165 Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 323 47 00 38	<b>SAMSUN</b> YATÇILIK GRUP SİYAHİ GAZLAR MAK. İNS. TAH. Marmara Adası Mah. 55/5. Sok. No: 1 Tel: 0 621 238 1082
<b>AYDIN</b>	<b>MAVİ OTOMASYON</b> Karaburun Mah. 25.50. Sok. No: 32/2. Nazilli Tel: 0 156 313 99 42	<b>ERZURUM</b> TEKNIK MAKİNA BOBİNİ Sınavlı Mah. 1. Sınavlı Mah. 15/2 Tel: 0 442 243 17 34	<b>KAYSERİ</b> YENİ METAL SAN. TİC. LTD. ŞTİ. 058 Mah. 5165 Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 323 47 11 54	<b>ŞANLIURFA</b> YESTİL MAKİNA HİDROVAT K. Sayı: 172 394 İşyeri Beyoğlu Tel: 0 621 233 17 58
<b>BALIKESİS</b>	<b>KARESI KAYNAK MERKEZİ</b> Pazarcık Mah. 24. Sok. No: 1/A Tel: 0 360 246 41 01	<b>Eskişehir</b> TEKMAŞ MAKİNA Tunceli Mah. 18/1. Sınavlı Mah. 117/8 Tel: 0 222 246 02 66	<b>K. MARAŞ</b> ELECTRO CENTER Büyükköy Mah. 25/5. Mah. 15/2 Tel: 0 345 256 00 96	<b>AFSAN BOBİNİ</b> K. Sayı: 172 394 İşyeri Beyoğlu Tel: 0 621 233 17 58
<b>BATMAN</b>	<b>TOPI BOBİNİ</b> Çamönü Mah. 112 Sok. No: 35/A Tel: 0 168 21 67 87	<b>Gaziantep</b> ÖZKAN BOBİNİ Liman Mah. 1. Sınavlı Mah. 15/2 Tel: 0 324 217 00 88	<b>UZUN BOBİNİ</b> HAMİDİYE Mah. Yeni Sınavlı Mah. 1865 Sok. No: 15 Tel: 0 388 217 00 79	<b>TEKİRDağ</b> TÜRK ELEKTRONİK Yeni Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 282 673 35 59
<b>BİNGÖL</b>	<b>HİDEF ELEKTRONİK MAKİNA</b> Bağışlı Mah. Sabahattin Kaya Cad. No: 47/8 Tel: 0 360 21 60 05 07	<b>HATAY</b> DİKTİŞ HİDROVAT Marmaris Mah. Yeni Sınavlı Mah. 893 Sok. No: 4/A Kuduhan Tel: 0 205 344 51 93	<b>KARABÜK</b> GÜVEN ELEKTRONİK Oğuz Mah. 5165 Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 288 61 37 61	<b>TRABZON</b> KIRKLARELİ Büyükköy Mah. 5165 Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 288 61 38 39
<b>BURSA</b>	<b>BLİMER KAYNAK MAKİNE</b> Beyler Mah. 1. Sınavlı Mah. 112 Sok. No: 35/A Tel: 0 241 441 97 86	<b>İSPARTA</b> TEKNIK EL ALETLER İ VE İŞİŞTAN MATERİELERİ Sınavlı Mah. 32/3. Sok. No: 27 Tel: 0 324 218 58 75	<b>KOCAELİ</b> EKOSİSTESENİK Sarıyayla Mah. 1. Sınavlı Mah. 15/2 Tel: 0 262 33 00 10	<b>TOKAT</b> NUSTRA İŞ MAKİNA İ VE İKTİDROLARI HİDROVAT Yeni Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 262 33 00 10
<b>BURSA</b>	<b>EKAV KAYNAK</b> Yıldız Mah. 500. Oto. Sınavlı Mah. 15/2. Nüfum Tel: 0 241 340 00 04	<b>İSTANBUL ANADOLU</b> EKİSİ TEKNİK Ayaklı Mah. Yeni Sınavlı Mah. 501 Sok. No: 21/1.İzmit Tel: 0 324 691 75 45	<b>KONYA</b> EKİSİ TEKNİK Eyüpa Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 316 345 11 77	<b>VAN</b> GARANTİ BOBİNİ Tekke Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 310 345 11 77
<b>BURSA</b>	<b>MAGHASEİ KAYNAK MAKİNALARI</b> Yıldız Mah. 500. Oto. Sınavlı Mah. 15/2. Nüfum Tel: 0 355 744 06 96	<b>İSTANBUL ANADOLU</b> SISTEMİK Eyüpa Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 242 23 00 01	<b>İSTANBUL AVRUPA</b> DEĞİŞİM HİDROVAT DİŞİC. LTD. ŞTİ. İzmit Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 212 67 13 46	<b>ZONGULDAK</b> GARANTİ BOBİNİ Büyükköy Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 262 33 00 10
<b>ÇANAKKALE</b>	<b>ÜÜDİG KAYNAK MAKİNLİLERİ</b> İğne Mah. 520/15. Sok. No: 30/1 Aşağıne Tuzcu Mah. 520/15. Sok. No: 30/1 Aşağıne Tel: 0 360 213 54 44	<b>İSTANBUL AVRUPA</b> İSTİWEL HİDROVAT İkiz Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 321 77 11 68 14	<b>İSTANBUL AVRUPA</b> METHAN TEHNİK MAKİNA Kocatepe Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 353 77 11 78 89	<b>KİBRİS</b> İLKAY. GENCLİ LTD. Kırmızı Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 321 366 54 04
<b>ÇORUM</b>	<b>KARDEŞLER BOBİNİ</b> Altı Mah. 5. Sok. No: 150/8. Mah. 5. Sok. No: 13 Aşağıne Tel: 0 361 213 23 30			

Güncel servis listemiz için [www.magmaweld.com](http://www.magmaweld.com) web sitemizi ziyaret ediniz.

## **İMALATÇI FİRMA**

Organize Sanayi Bölgesi 5. Kısım Yalçın Özaras Caddesi No: 1  
45030, MANİSA, Türkiye

T: (+90) 236 226 27 28

## **Made in TÜRKİYE**

10.06.2020

UM\_MONOTB160\_072013\_062020\_001\_36

---



(+90) 444 93 53  
[magmaweld.com](http://magmaweld.com)  
[info@magmaweld.com](mailto:info@magmaweld.com)