



USER MANUAL

KULLANIM KILAVUZU

Megastick



EN DC WELDING INVERTER

TR DC KAYNAK İNVERTÖRÜ

(+90) 444 93 53
magmaweld.com
info@magmaweld.com

(+90) 538 927 12 62

Customer Service / Müşteri Hizmetleri: (+90) 444 93 53

E-Mail / E-Posta: info@magmaweld.com

Organize Sanayi Bölgesi, 5. Kısım 45030 Manisa / TURKEY

*All rights reserved. It is prohibited to reproduce this documentation, or any part thereof, without the prior written authorisation of Magma Mekatronik Makine Sanayi ve Ticaret A.Ş.
Magma Mekatronik may modify the information and the images without any prior notice.*

*Tüm hakları saklıdır. Magma Mekatronik Makine Sanayi ve Ticaret A.Ş.'nın yazılı izni olmaksızın bu dökümanın tamamının yada bir bölümünün kopyalanması yasaktır.
Magma Mekatronik önceden haber vermemeksizin bilgilerde ve resimlerde değişiklik yapılabilir.*

 **CONTENTS**

EN

TR

SAFETY PRECAUTIONS	4
1 TECHNICAL INFORMATION	10
1.1 General Information	10
1.2 Machine Components	10
1.3 Product Label	11
1.4 Technical Data	12
1.5 Accessories	12
2 INSTALLATION	13
2.1 Delivery Control	13
2.2 Installation And Operation Recommendations	13
2.3 Covered Electrode And TIG Welding Connections	14
3 OPERATION	15
3.1 User Interface	15
3.2 Machine Features	15
4 MAINTENANCE AND SERVICE	16
4.1 Maintenance	16
4.2 Trouble Shooting	17
5 ANNEX 1 - SPARE PARTS LIST	18
6 ANNEX 2 - CIRCUIT CHART	19

SAFETY PRECAUTIONS

Be Sure To Follow All Safety Rules In This Manual!

- Explanation Of Safety Information**
- Safety symbols found in the manual are used to identify potential hazards.
 - When any one of the safety symbols are seen in this manual, it must be understood that there is a risk of injury and the following instructions should be read carefully to avoid potential hazards.
 - The possessor of the machine is responsible for preventing unauthorized persons from accessing the equipment.
 - Persons using the machine must be experienced or fully trained in welding; they have to read the user manual before operation and follow the safety instructions.



Explanation Of Safety Symbols



ATTENTION

Indicates a potentially hazardous situation that could cause injury or damage. In case if no precaution is taken, it may cause injuries or material losses / damages.



IMPORTANT

Specifies notifications and alerts on how to operate the machine.



DANGER


Indicates a serious danger. In case if not avoided, severe or fatal injuries may occur.

Comprehending Safety Precautions

- Read the user manual, the label on the machine and the safety instructions carefully.
- Make sure that the warning labels on the machine are in good condition. Replace missing and damaged labels.
- Learn how to operate the machine, how to make the checks in a correct manner.
- Use your machine in suitable working environments.
- Improper changes made in your machine will negatively affect the safe operation and its longevity.
- The manufacturer is not responsible for the consequences resulting from the operation of the device beyond the specified conditions.

Electric Shocks May Kill

Make certain that the installation procedures comply with national electrical standards and other relevant regulations, and ensure that the machine is installed by authorized persons.

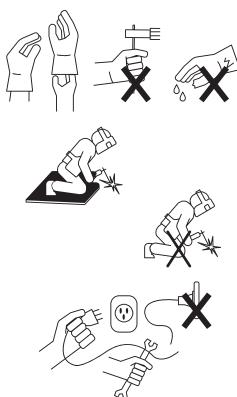

- Wear dry and sturdy insulated gloves and working apron. Never use wet or damaged gloves and working aprons.
- Do not touch the electrode with the bare hand.
- Never touch parts that carry electricity.
- Never touch the electrode if you are in contact with the electrode attached to the work surface, floor or another machine.
- By isolating yourself from the work surface and the floor, you can protect yourself from possible electric shocks. Use a non-flammable, electrically insulating, dry and undamaged insulation material that is large enough to cut off the operator's contact with the work surface.
- Do not connect more than one electrode to the electrode holder. Keep the machine turned off when not in use.
- Before repairing the machine, remove all power connections and/or connector plugs or turn off the machine.
- Be careful when using a long mains cable.
- Check all cables frequently for possible damage. If a damaged or an uninsulated cable is detected, repair or replace it immediately.
- Make sure that the grounding of the power line is properly connected.

Moving Parts May**Cause Injuries**

- Keep away from the moving parts.

Keep all protective devices such as covers, panels, flaps, etc., of machinery and equipment closed and in locked position.

- Wear metal toe shoes against the possibility of heavy objects falling on to your feet.

**Fumes and Gases
May Be Harmful To
Your Health**

Long-term inhalation of fumes and gases released from welding and cutting is very dangerous.

- Burning sensations and irritations in the eyes, nose and throat are signs of inadequate ventilation. In such a case, immediately boost the ventilation of the work area, and if the problem persists, stop the welding process completely.
- Create a natural or artificial ventilation system in the work area.
- Use a suitable fume extraction system where welding and cutting works are being carried out. If necessary, install a system that can expel fumes and gases accumulated in the entire workshop. Use a suitable filtration system to avoid polluting the environment during discharge.
- If you are working in narrow and confined spaces or if you are welding lead, beryllium, cadmium, zinc, coated or painted materials, use masks that provide fresh air in addition to the above precautions.
- If the gas tanks are grouped in a separate zone, ensure that they are well ventilated, keep the main valves closed when gas cylinders are not in use, pay attention to possible gas leaks.
- Shielding gases such as argon are denser than air and can be inhaled instead of air if used in confined spaces. This is dangerous for your health as well.
- Do not perform welding operations in the presence of chlorinated hydrocarbon vapors released during lubrication or painting operations.

**Arc Light May
Damage Your Eyes
and Skin**

- Use a suitable protective mask and glass filter (4 to 13 according to EN 379) suitable for that to protect your eyes and face.
- Protect other naked parts of your body (arms, neck, ears, etc.) with suitable protective clothing from these rays.
- Enclose your work area with flame-resistant folding screens and hang warning signs at eye level so that people around you will not sustain injuries from arc rays and hot metals.
- This machine is not used for heating of icebound pipes. This operation performed with the welding machine causes explosion, fire or damage to your installation.

**Sparks and Spattering Particles
May Get Into Eyes and
Cause Damage**

- Performing works such as welding, surface grinding, and brushing cause sparks and metal particles to splatter. Wear approved protective work goggles which have edge guards under the welding masks to prevent sustaining possible injuries

**Hot Parts May Cause
Severe Burns**

- Do not touch the hot parts with bare hands.

Wait until the time required for the machine to cool down before working on its parts.

- If you need to hold hot parts, use suitable tools, welding gloves with high-level thermal insulation and fire-resistant clothes.

**Noise May Cause
Damage To Your
Hearing Ability**

- The noise generated by some equipment and operations may damage your hearing ability.

Wear approved personal ear protective equipment if the noise level is high.

Welding Wires Can Cause Injuries



- Do not point the torch towards any part of the body, other persons, or any metal while unwrapping the welding wire.
- When welding wire is run manually from the roller especially in thin diameters the wire can slip out of your hand, like a spring or can cause damage to you or other people around, therefore you must protect your eyes and face while working on this.

Welding Operations May Cause Fire and Explosion



- Never perform welding work in places near flammable materials. There may be fire or explosions.
- Before starting the welding work, remove these materials from the environment or cover them with protective covers to prevent combustions and flaring.
- National and international special rules apply in these areas.
- Do not apply welding or cutting operations into completely closed tanks or pipes.
- Before welding to tanks and closed containers, open them, completely empty them, and clean them. Pay the greatest attention possible to the welding operations you will perform in such places.
- Do not weld in tanks and pipes which might have previously contained substances that may cause explosions, fires or other reactions.
- Welding equipment heats up. For this reason, do not place it on surfaces that could easily burn or be damaged!
- Welding sparks can cause fire. For this reason, keep materials such as fire extinguishers tubes, water, and sand in easily accessible places.
- Use holding valves, gas regulators and valves on flammable, explosive and compressed gas circuits. Make sure that they are periodically inspected and pay attention that they run reliably.

Maintenance Work Performed by Unauthorized Persons To Machines and Apparatus May Cause Injuries



- Electrical equipment should not be repaired by unauthorized persons. Errors occurred if failed to do so may result in serious injury or death when using the equipment.
- The gas circuit elements operate under pressure; explosions may occur as a result of services provided by unauthorized persons, users may sustain serious injuries.
- It is recommended to perform technical maintenance of the machine and its auxiliary units at least once a year.

Welding In Small Sized and Confined Spaces



- In small-sized and confined spaces, absolutely make sure to perform welding and cutting operations, accompanied by another person.
- Avoid performing welding and cutting operations in such enclosed areas as much as possible.

Failure To Take Precautions During Transport May Cause Accidents



- Take all necessary precautions when moving the machine. The areas where the machine to be transported, parts to be used in transportation and the physical conditions and health of the person carrying out the transportation works should be suitable for the transportation process.
- Some machines are extremely heavy; therefore, make sure that the necessary environmental safety measures are taken when changing their places.
- If the welding machine is to be used on a platform, it must be checked that this platform has suitable load bearing limits.
- If it is to be transported by means of a haulage vehicle (transport trolley, forklift etc.), make sure of the durableness of the vehicle, and the connection points (carrying suspenders, straps, bolts, nuts, wheels, etc.) that connect the machine to this vehicle.
- If the machine will be carried manually, make sure the durableness of the machine apparatuses (carrying suspenders, straps, etc.) and connections.
- Observe the International Labor Organization's rules on carriage weights and the transport regulations in force in your country in order to ensure the necessary transport conditions.

- Always use handles or carrying rings when relocating the power-supply sources.
- Never pull from torches, cables or hoses. Be absolutely sure to carry gas cylinders separately.
- Remove all interconnections before transporting the welding and cutting equipment, each being separately, lift and transport small ones using its handles, and the big ones from its handling rings or by using appropriate haulage equipment, such as forklifts.

Falling Parts May Cause Injuries



Improper positioning of the power-supply sources or other equipment can cause serious injury to persons and physical damage to other objects.

- Place your machine on the floor and platforms with a maximum tilt of 10° so that it does not fall or tip over. Choose places that do not interfere with the flow of materials, where there is no risk of tripping over on cables and hoses; yet, large, easily ventilatable, dust-free areas. To prevent gas cylinders from tipping over, on machines with a gas platform suitable for the tanks, fix the tanks on to the platform; in stationary usage applications, fix them to the wall with a chain in a way that they would not tip over for sure.
- Allow operators to easily access settings and connections on the machine.

Excessive Use Of The Machine Causes Overheating



- Allow the machine to cool down according to operation cycle rates.
- Reduce the current or operation cycle rate before starting the welding again.
- Do not block the fronts of air vents of the machines.
- Do not put filters that do not have manufacturer approvals into the machine's ventilation ports.

Excessive Use Of The Machine Causes Overheating



- This device is in group 2, class A in EMC tests according to TS EN 55011 standard.
- This class A device is not intended for use in residential areas where electrical power is supplied from a low-voltage power supply. There may be potential difficulties in providing electromagnetic compatibility due to radio frequency interference transmitted and emitted in such places.

 This device is not compliant with IEC 61000-3-12. In case if it is desired to be connected to the low voltage network used in the home, the installer to make the electrical connection or the person who will use the machine must be aware that the machine has been connected in such a manner; in this case the responsibility belongs to the user.

- Make sure that the work area complies with electromagnetic compatibility (EMC). Electromagnetic interferences during welding or cutting operations may cause undesired effects on your electronic devices and network; and the effects of these interferences that may occur during these operations are under the responsibility of the user.
- If there is any interference, to ensure compliance; extra measures may be taken, such as the use of short cables, use of shielded (armored) cables, transportation of the welding machine to another location, removal of cables from the affected device and/or area, use of filters or taking the work area under protection in terms of EMC.
- To avoid possible EMC damage, make sure to perform your welding operations as far away from your sensitive electronic devices as possible (100m).
- Ensure that your welding and/or cutting machine has been installed and situated in its place according to the user manual.

Evaluation Of Electromagnetic**Suitability Of The
Work Area****According to article 5.2 of IEC 60974-9;**

Before installing the welding and cutting equipment, the person in charge of the operation and/or the user must conduct an inspection of possible electromagnetic interference in the environment. Aspects indicated below has to be taken into consideration;

- a) Other supply cables, control cables, signal and telephone cables, above and below the welding machine and its equipment,
- b) Radio and television transmitters and receivers,
- c) Computer and other control hardware,
- d) Critical safety equipment, e.g. protection of industrial equipment,
- e) Medical apparatus for people in the vicinity, e.g. pacemakers and hearing aids,
- f) Equipment used for measuring or calibration,
- g) Immunity of other equipment in the environment. The user must ensure that the other equipment in use in the environment is compatible. This may require additional protection measures.
- h) Considering the time during which the welding operations or other activities take place during the day, the boundaries of the investigation area can be expanded according to the size of the building, the structure of the building and other activities that are being performed in the building.

In addition to the evaluation of the field, evaluation of device installations may also be necessary for solving the interfering effect.

In case if deemed necessary, on-site measurements can also be used to confirm the efficiency of mitigation measures. (Source: IEC 60974-9).

**Electromagnetic Interference
Reduction Methods**

- The appliance must be connected to the electricity supply in the recommended manner by a competent person. If interference occurs, additional measures may be applied, such as filtering the network.
- The supply of the fixed-mounted arc welding equipment must be made in a metal tube or with an equivalent shielded cable. The housing of the power supply must be connected and a good electrical contact between these two structures has to be provided.
- The recommended routine maintenance of the appliance must be carried out. All covers on the body of the machine must be closed and/or locked when the device is in use. Any changes, other than the standard settings without the written approval of the manufacturer, cannot be modified on the appliance. Otherwise, the user is responsible for any consequences that may possibly occur.
- Welding cables should be kept as short as possible. They must move along the floor of the work area, in a side by side manner. Welding cables should not be wound in any way.
- A magnetic field is generated on the machine during welding. This may cause the machine to pull metal parts on to itself. To avoid this attraction, make sure that the metal materials are at a safe distance or fixed. The operator must be insulated from all these interconnected metal materials.
- In cases where the workpiece cannot be connected to the ground due to electrical safety, or because of its size and position (for example, in building marine vessel bodies or in steel construction manufacturing), a connection between the workpiece and the grounding may reduce emissions in some cases, it should be kept in mind that grounding of the workpiece may cause users to sustain injuries or other electrical equipment in the environment to break down. In cases where necessary, the workpiece and the grounding connection can be made as a direct connection, but in some countries where direct connection is not permissible, the connection can be established using appropriate capacity elements in accordance with local regulations and ordinances.
- Screening and shielding of other devices and cables in the work area can prevent aliasing effects. Screening of the entire welding area can be evaluated for some specific applications.

Arc Welding May Cause Electromagnetic Field (EMF) The electrical current passing through any conductor generates zonal electric and magnetic fields (EMF). All welders must follow the following procedures to minimize the risk of exposure to EMF from the welding circuit;



- In the name of reducing the magnetic field, the welding cables must be assembled and secured as far as possible with the joining materials (tape, cable ties etc.).
- The welder's/worker's body and head should be kept as far away from the welding machine and cables as possible,
- Welding cables should not be wrapped around the body of the machine in any way,
- The body of the machine should not get caught between the welding cables. The source cables must be kept away from the body of the machine, both being placed side by side,
- The return cable must be connected to the workpiece as close as possible to the welded area,
- The welding machine should not rest against the power unit, ensconce on it and not work too close to it,
- Welding work should not be performed when carrying the welding wire supply unit or welding power unit.

EMF may also disrupt the operation of medical implants (materials placed inside the body), such as pacemakers. Protective measures should be taken for people who carry medical implants. For example, access limitation may be imposed for passers-by, or individual risk assessments may be conducted for welders. Risk assessment should be conducted and recommendations should be made by a medical professional for users who carry medical implants.

Protection • Do not expose the machine to rain, prevent the machine from splashing water or pressurized steam.



Energy Efficiency • Choose the welding method and welding machine for the welding work you are to perform.



- Select the welding current and/or voltage to match the material and thickness you are going to weld.
- If you have to wait for a long time before you start your welding work, turn off the machine after the fan has cooled it down. Our machines (our products) with smart fan control will turn off on their own.

Waste Procedure • This device is not domestic waste. It must be directed to recycling within the framework of the European Union directive and national laws.



- Obtain information from your dealer and authorized persons about the waste management of your used machines.

TECHNICAL INFORMATION

1.1 General Information

MEGASTICK is an easy-to-carry 200A welding machine with direct current output (DC), produced with single-phase inverter technology, capable of burning a shielded metal arc up to 4.00 mm.

It can also be used as a DC TIG welding machine by the arc start method by touching the tungsten end's workpiece with a TIG Torch with valve. *

It is compatible with working with generator. It can also be used with welding cables up to 25 meters long. Fan cooled and thermally protected against overheating.

(*) For more information on TIG welding, see page 14.

1.2 Machine Components

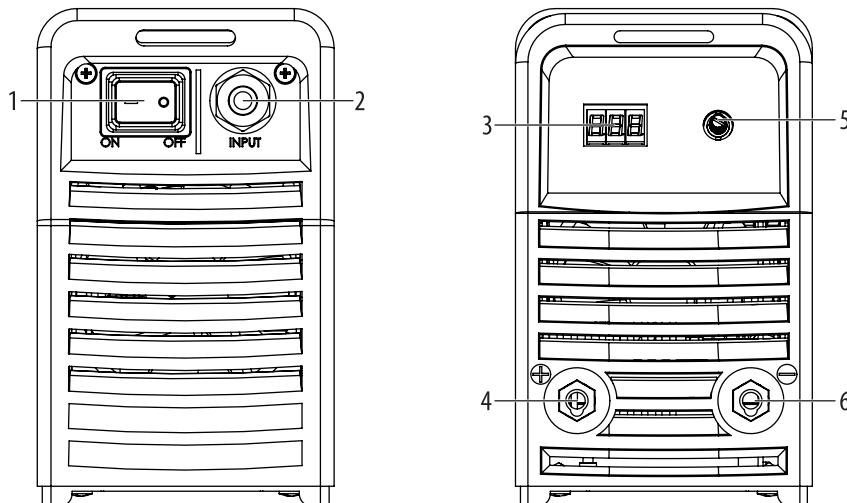


Figure 1: MEGASTICK

1- On/Off Power Switch

2- Supply Cable Entry

3- Digital Display

4- Welding and Grounding Cable Socket (+)


5- Current Adjustment Knob

6- Welding and Grounding Cable Socket (-)

1.3 Product Label

MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.			
Organize Sanayi Bölgesi 5.Kısim Manisa-TÜRKİYE			
MEGASTICK		Seri No :	
		X	10A / 20.4V - 200A / 28V
		I ₂	14% 60% 100%
		U ₂	200A 100A 85A
		I ₁	28V 24V 23.4V
		S ₁	42.1A 19.8A 15.6A
		U ₁	9.68 kVA 4.55kVA 3.59kVA
		I _{max}	I _{eff} = 42.1A 15.76A
		1~50-60 Hz	
		U ₁ =230V	
		S ₁	IP23S
			CE

	Mono Phase Static Frequency Converter Transformer Rectifier
	Shielded Metal Arc Welding
	Direct Current
	Vertical Characteristic
	Mains Input- Mono Phase Alternating
	Suitable for Working in Hazardous Environments
X	Operation Cycle
U ₀	Open-Circuit Voltage
U ₁	Supply Voltage and Frequency
U ₂	Conventional Charge Voltage
I ₁	Rated Supply Current
I ₂	Rated Welding Current
IP23S	Protection Class
S ₁	Power Drawn From The Mains

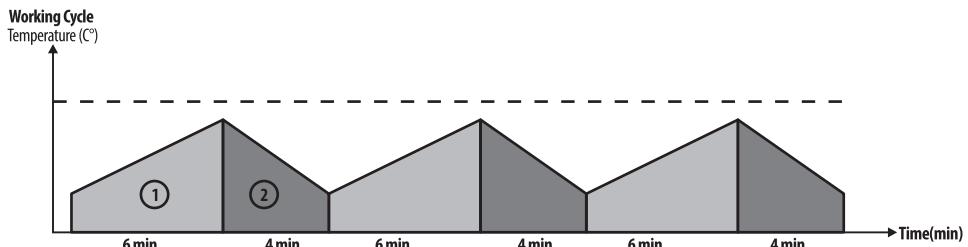

As defined in the standard EN 60974-1, the operating cycle rate includes a time period of 10 minutes. For example, if a machine specified as 250A at %60 is to be operated at 250A, the machine can weld without interruption in the first 6 minutes of the 10 minutes period (zone 1). However, the following 4 minutes should be kept idle for the machine cool down (zone 2).

1.4 Technical Data

TECHNICAL DATA	UNIT	VALUE
Mains Voltage (1 Phaze - 50-60 Hz)	V	230
Power Drawn from the Mains (%14)	kVA	9,68
Current Drawn from the Mains (%14)	A	42,1
Power Factor		0,67
Idle Voltage	VDC	75
Welding Current Setting Range	ADC	10-200
Rated Welding Current (%14)	ADC	200
Protection Class		IP23S
Cooling System		Air
Dimensions (LxWxH)	mm	360x120x200
Weight	kg	5
Fuse	A	50
Standards And Approval		CE,EN60974-1,EN60974-10

1.5 Accessories

STANDARD ACCESSORIES

Megastick

(For The Boxed Version)	PIECE	PRODUCT CODE
Elektrode Clamp and Cable	1	7906102502
Grounding Pliers and Cable	1	7905102502

Megastick Deluxe

(For The Briefcase Version)	PIECE	PRODUCT CODE
Electrode Clamp and Cable	1	7906102502
Grounding Pliers and Cable	1	7905102502
Wire Brush / Hammer	1	8369000175
Handheld Mask	1	8502301007
Elektrode (Package)	1	11101NAEM1

🔧 INSTALLATION

EN

2.1 Delivery Control

Make sure that all the materials you have ordered have been received. If any material is missing or damaged, contact your place of purchase immediately.

The standard box includes the following:

- Main machine and connected mains cable
- Grounding clamps and cable
- Electrode clamps and cable
- Strap Belt
- Arantty certificate
- User manual

The standard bag version includes:

- Main machine and connected mains cable
- Grounding clamps and cable
- Electrode clamps and cable
- Wire Brush / Hammer
- Welding hand mask
- User manual
- Electrode (1 pack)
- Strap Belt
- Arantty certificate

In case of a damaged delivery, record a report, take a picture of the damage and report to the transport company together with a photocopy of the delivery note. If the problem persists, contact the customer service.

Symbols and their meanings on the device;



Welding process is dangerous. Proper working conditions should be ensured and necessary precautions should be taken. Specialists are responsible for the machine and have to be equipped with the necessary equipment and those who are not relevant should be kept away from the welding area.



This device is not compatible with IEC 61000-3-12. If it is desired to connect to the low voltage mains used in homes, it is essential that the installer or the person who will operate the machine to make the electrical connection has information on the machine's connectivity. In this case the responsibility will be assumed by the person who will perform the installation or by the operator.



The safety symbols and warning notes on the device and in the operating instructions must be observed and the labels must not be removed.



Grids are intended for ventilation. The openings should not be covered in order to provide good cooling and no foreign objects should be inserted.

2.2 Installation And Operation Recommendations

For better performance, place the machine at least 30 cm away from the surrounding objects. Pay attention to overheating, dust and moisture near the machine. Do not operate the machine under direct sunlight. If the ambient temperature exceeds 40°C, operate the machine at a lower current or a lower operating cycle.

Avoid welding outdoors in windy and rainy weather circumstances. If welding is necessary in such cases, protect the welding area and the welding machine with a curtain and canopy.

If you weld indoors, use a suitable smoke extraction system. Use breathing apparatus if there is a risk of inhaling welding fumes and gas in confined spaces.

Observe the operating cycle rates specified on the product label. Suspending operating cycle rates can damage the machine and this may invalidate the warranty. Use the fuse that is compliant with your system.

Tighten the ground wire as close as possible to the welding area. Do not allow the welding current to pass through equipment other than the welding cables.

If TIG is to be applied with a plug torch, secure the gas cylinder in a way not causing any hazards.

The welding cables and the mains cable must not be wrapped in the machine housing during operation.

2.3 Covered Electrode And TIG Welding Connections



Check the mains voltage before connecting the machine to the mains.

When plugging the power plug into the outlet, make sure that the power switch is set to "0" in the turned-off position.

For covered electrode welding:

- Start the machine with the on / off switch (1) and check to see that the cooling fan is working or not. Insert the welding and grounding cable into the welding and grounding cable sockets (4-6) according to the electrode to be used and poles that are recommended by the manufacturer of the electrode. Make sure to tighten them by wringing them towards clockwise.
- Connect the ground pliers to the workpiece as close as possible to the welding area.

For TIG welding:

- Start the machine with the On/Off Power Switch (1) and check to see that the cooling fan is working or not.
- A TIG torch with a gas valve has to be used.
- Connect the power cable of the TIG torch to the negative pole socket (6) and connect the grounding cable to the positive pole socket (4).
- Connect the argon gas regulator to the argon gas tank.
- Connect the gas hose of the torch to the gas regulator.

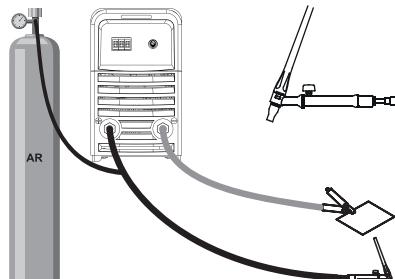


Figure 2: TIG Welding Connections

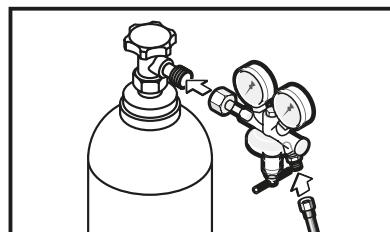



Figure 3: Gas Cylinder Connection

The following table is a reference for the amperage setting of non-alloy steels. Please make sure to follow the recommendations of the electrode manufacturer at all times.

Covered Electrode Diameter (mm)	Recommended Welding Current	
	Rutile	Basic
2.0	40-60 A	-
2.5	60-90 A	60-90 A
3.2	100-140 A	100-130 A
4.0	140-180 A	140-180 A

 **OPERATION**

EN

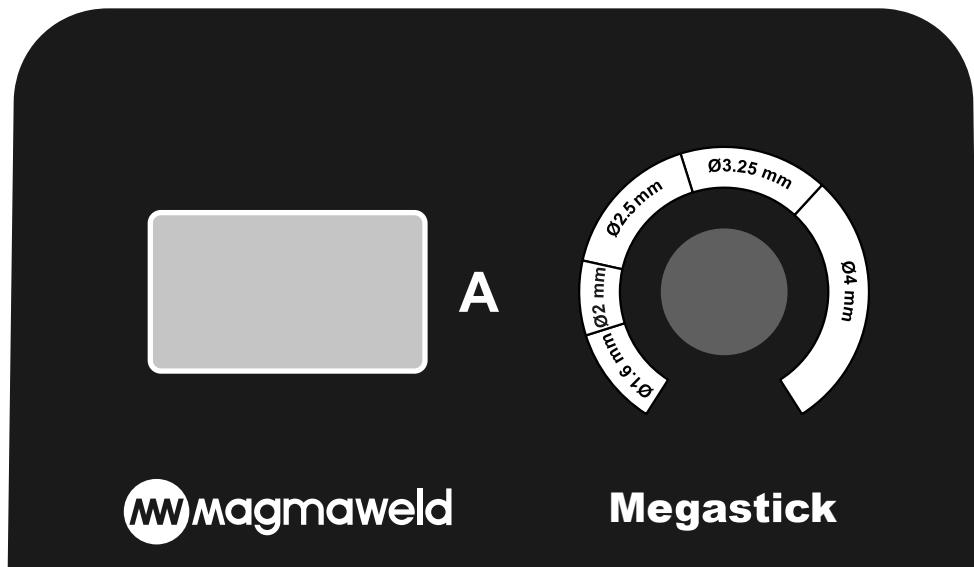 **3.1 User Interface**

	<p>The Megastick control panel with its user-friendly interface includes digital display and a current adjustment pod.</p>
	<p>A Digital Display</p> <ul style="list-style-type: none">• Current during welding are monitored from the digital display.
	<p>Current Adjustment Pod</p> <ul style="list-style-type: none">• There is a current setting scale around the current setting pot. With this current setting scale you can select the electrode diameter you want to burn.

 **3.2 Machine Features**

- It is an MMA light weight, portable machine that can perform welding works in the range of 10-200 A, and it is very high in performance compared to its size.
- Its rutile and basic electrode performances are excellent.
- Weighs 5 kg and it has small, compact size.
- Fully meets EMC testing and CE requirements.
- The kVA value for the generator to be selected should be determined by checking the technical specifications of the machine (Page 12).

EN

MAINTENANCE AND SERVICE

 
- Maintenance and repairs to the machine must be carried out by a qualified personnel. Our company will not be responsible for any accidents that may occur by unauthorized interventions.
- Parts that will be used during repair can be obtained from our authorized services. The use of original spare parts will extend the life of your machine and prevent performance losses.
- Always contact the manufacturer or an authorized service specified by the manufacturer.
- Any unauthorized repair attempt other than by the manufacturer during the warranty period will cause all warranty provisions to be void.
- Always comply with the applicable safety regulations during maintenance and repair.
- Before performing any work on the machine for repair, disconnect the machine's power plug from the power supply and wait for 10 seconds for the capacitors to discharge.



4.1 Maintenance


Daily Maintenance

- Do not remove the warning labels on the device. Replace the worn/torn labels with the new ones. Labels can be obtained from the authorized service.
- Check your clamps and cables. Pay attention to the connections and the durableness of the parts. Replace the damaged/defective parts with the new ones. Do not ever make additions to/repair the cables.
- Ensure adequate space for ventilation.
- The supplies on the optional TIG torch must be cleaned regularly. Should be replaced if necessary. It should be ensured that these materials are original products for a long-term use.



Every 6 Months

- Clean and tighten fasteners such as bolts and nuts.
- Check the electrode clamp and grounding clamp cables.
- Open the side covers of the machine and clean with low pressure dry air. Do not apply compressed air to electronic components at close distance

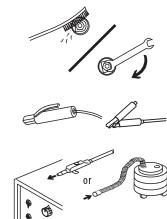


NOTE: The above mentioned periods are the maximum ones that should be applied if no problems are encountered in your device. Depending on the work load and contamination of your work environment, you can repeat the above processes more frequently.

4.2 Trouble Shooting

The following tables contain possible errors to be encountered and their solutions.

Error Code	Solution
Thermal LED on the front panel has lit up	<ul style="list-style-type: none">The machine's operation cycle rate may be exceeded. Wait for a while to allow the machine to cool down. If the failure disappears, try to use lower amperage values.The fan may not be working. Inspect the fan for to see if it is functioning properly. If it is still not working, please contact the authorized service center.The air inlet and outlet ducts may be blocked. Clear the air ducts from any blockage.The machine operating environment can be extremely hot or airless. Have the machine placed in an environment where it can work more comfortably.
Machine does not work at all	<ul style="list-style-type: none">Make sure that the machine is connected to power.Check that the mains connections are correct.Check the mains power supply fuses, mains cable and its plug.Check the on / off operating switch.If you have made all the checks and if the problem still persists, please contact the authorized service center.
Machine does not weld / welds poorly	<ul style="list-style-type: none">Make sure that the machine's grounding pliers are connected to the workpiece.Make sure that the cables are secure and that the connection points are not wornMake sure that the parameter and process selection are correct.According to the process you have chosen, follow the steps below:Check the pole that the electrode must be connected and the current value that must be set on the machine.Check that the gas flow is open, ensuring that the flow is accurate.Make sure that the tungsten tip is clean.Make sure the durableness of the welding torch.If you have made all the checks, if the problem still persists, please contact the authorized service center.


EN

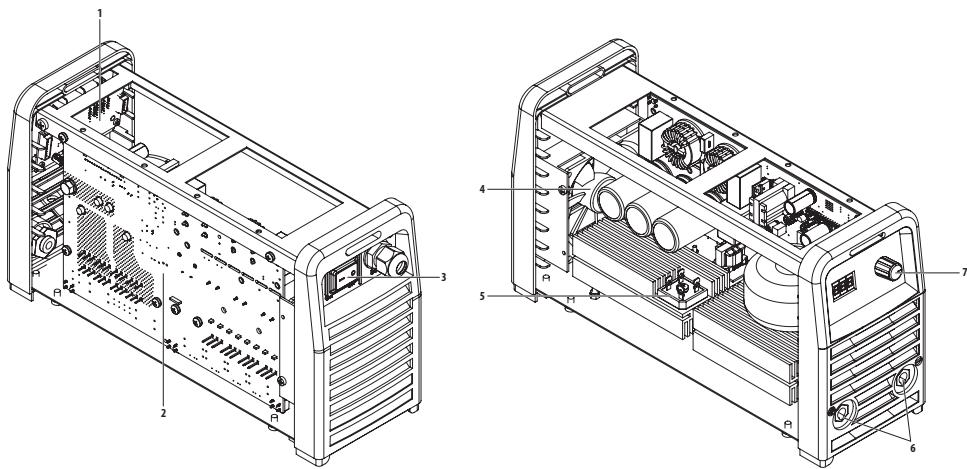
ANNEX 1 - SPARE PARTS LIST


NO	DEFINITION	MATERIAL CODE
1	Electronic Card	K405000306
2	Electronic Card	K405000308
3	On/Off Switch	A310100011
4	Fan Mono	A250001024
5	Bridge Diode GBPC5010-G	A430901023
6	Welding Plug	A377900103
7	Potency Knob	A229500004
	Hall Effect Sensor	A834000001
	Electronic Card	K405000307

ANNEX 2 - CIRCUIT CHART

EN

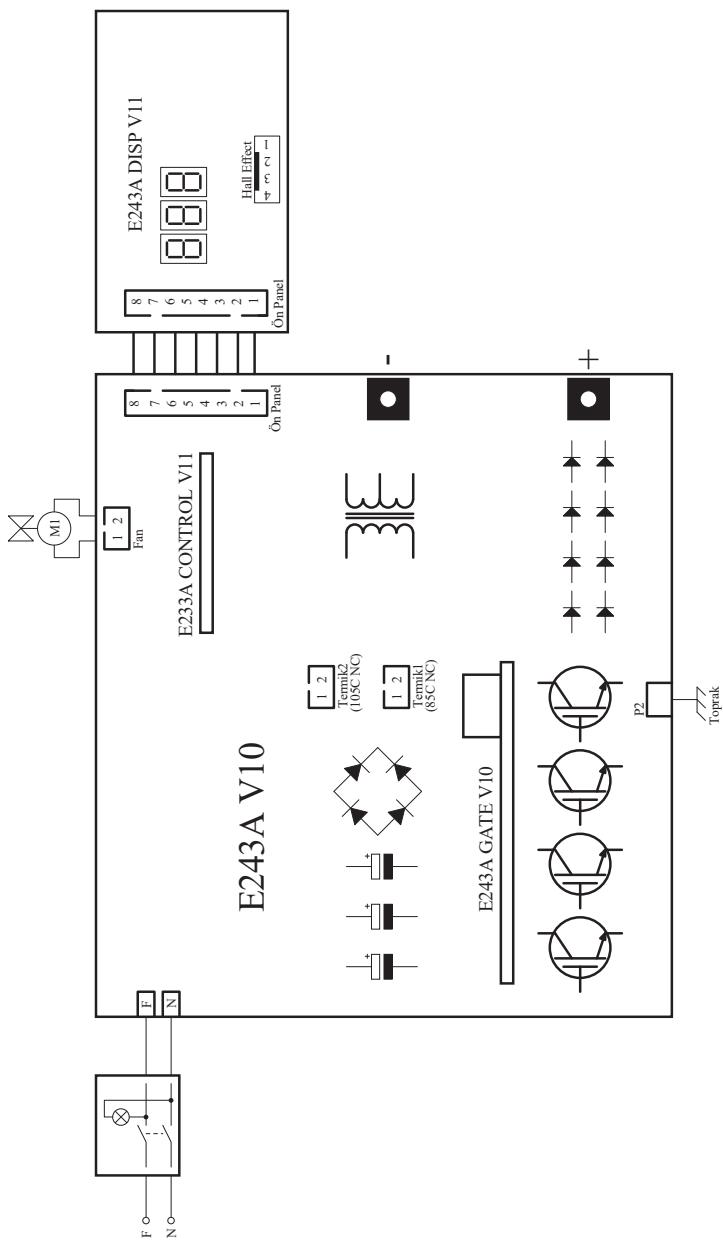



 **İÇİNDEKİLER**

GÜVENLİK KURALLARI	22
1 Teknik Bilgiler	28
1.1 Genel Açıklamalar	28
1.2 Makine Bileşenleri	28
1.3 Ürün Etiketi	29
1.4 Teknik Özellikler	30
1.5 Aksesuarlar	30
2 KURULUM BİLGİLERİ	31
2.1 Teslim Alırken Dikkat Edilecek Hususlar	31
2.2 Kurulum ve Çalışma Tavsiyeleri	31
2.3 Örtülü Elektrod ve TIG Kaynağı İçin Bağlantılar	32
3 KULLANIM BİLGİLERİ	33
3.1 Kullanıcı Arayüzü	33
3.2 Makine Özellikleri	33
4 BAKIM VE ARIZA BİLGİLERİ	34
4.1 Bakım	34
4.2 Hata Giderme	35
5 EK 1 - YEDEK PARÇA LİSTESİ	36
6 EK 2 - DEVRE ŞEMASI	37

TR

GÜVENLİK KURALLARI

TR

Kılavuzda Yer Alan Tüm Güvenlik Kurallarına Uyun!

Güvenlik Bilgilerinin Tanımlanması

Tanımlanması



- Kılavuzda yer alan güvenlik sembollerini potansiyel tehlikelerin tanımlanmasında kullanılır.
- Bu kılavuzda herhangi bir güvenlik simgesi görüldüğünde, bir yaralanma riski olduğu anlaşılmalı ve takip eden açıklamalar dikkatlice okunarak clası tehlikeler engellenmelidir.
- Makine sahibi, yetkisiz kişilerin ekipmana erişmesini engellemekten sorumludur.
- Makineyi kullanan kişiler kaynak konusunda deneyimli veya tam eğitimli kişiler olup; çalışma öncesinde kullanma kılavuzunu okumalı ve güvenlik uyarlarına uymalıdır.

Güvenlik Sembollerinin Tanımlanması



DİKKAT

Yaralanma ya da hasara neden olabilecek potansiyel tehlikeli bir durumu belirtir. Önlem alınmaması durumunda yaralanmalara veya maddi kayıplara/hasarlara neden olabilir.



ÖNEMLİ

Kullanıma yönelik bilgilendirmeleri ve uyarıları belirtir.



TEHLİKE

Ciddi tehlike olduğunu gösterir. Kaçınılmaması durumunda ölüm veya ağır yaralanmalar meydana gelebilir.


Güvenlik Uyarılarının Kavranması

- Kullanım kılavuzunu, makine üzerindeki etiket ve güvenlik uyarılarını dikkatli bir şekilde okuyunuz.
- Makine üzerindeki uyarı etiketlerinin iyi durumda olduğundan emin olunuz. Eksik ve hasarlı etiketleri değiştiriniz.
- Makinenin nasıl çalıştırıldığını, kontrollerinin doğru bir şekilde nasıl yapılacağını öğreniniz.
- Makinenizi uygun çalışma ortamlarında kullanınız.
- Makinenizde yapılabilecek uygunsuz değişiklikler makinenizin güvenli çalışmasına ve kullanım ömrüne olumsuz etki eder.
- Cihazın belirtilen koşullar dışında çalıştırılmasından doğan sonuçlardan üretici sorumlu değildir.

Elektrik Çarpmaları Öldürebilir



Kurulum prosedürlerinin ulusal elektrik standartlarına ve diğer ilgili yönetmeliklere uygun olduğunu emin olun ve makinenin yetkili kişiler tarafından kurulmasını sağlayın.

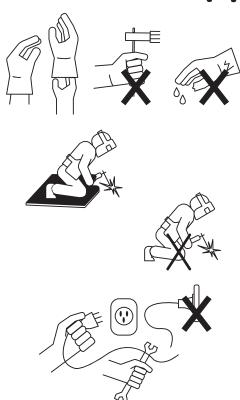

- Kuru ve sağlam izolasyonlu eldiven ve iş önlüğü giyin. İslak ya da hasar görmüş eldiven ve iş önlüklerini kesinlikle kullanmayın.
- Elektroda çiplak elle dokunmayın.
- Elektrik taşıyan parçalara kesinlikle dokunmayın.
- Eğer çalışma yüzeyine, zemine ya da başka bir makineye bağlı elektrodla temas halindeyseniz kesinlikle elektroda dokunmayın.
- Çalışma yüzeyinden ve zeminden kendinizi izole ederek olası muhtemel elektrik şoklarından koruna bilirsiniz. Çalışma yüzeyiyle operatörün temasını keserek kadar büyük, yanmaz, elektriksiz ağıdan yalıtkan, kuru ve hasarsız izolasyon malzemeleri kullanın.
- Elektrod pencesine birden fazla elektrod bağlamayın.
- Makineyi kullanmadığınız durumlarda kapalı tutun.
- Makineyi tamir etmeden önce tüm güç bağlantılarını ve/veya bağlantı fışlarını çıkartın ya da makineyi kapatın.
- Uzun şebeke kablosu kullanırken dikkatli olun.
- Tüm kabloları olası hasarlarla karşı sık sık kontrol edin. Hasarlı ya da izolasyonsuz bir kablo tespit edildiğinde derhal tamir edin veya değiştirin.
- Elektrik hattının topraklamasının doğru yapıldığından emin olun.

Hareketli Parçalar Yaralanmaları**Yol Açıabilir**

- Hareket halinde olan nesnelerden uzak durun.

- Makine ve cihazlara ait tüm kapak, panel, kapı, vb. koruyucuları kapalı ve kilitli tutun.
- Ağır cisimlerin düşme olasılığuna karşı metal burunlu ayakkabı giyin.

Duman ve Gazlar**Sağlığınız İçin****Zararlı Olabilir**

Kaynak ve kesme işlemi yapıldıken çıkan duman ve gazın uzun süre solunması çok tehlikelidir.

- Gözlerde, burunda ve boğazda meydana gelen yanma hissi ve tahlıller, yetersiz havalandırmanın belirtirleridir. Böyle bir durumda derhal havalandırmayı arttırın, sorunun devam etmesi halinde kaynak işlemini durdurun.
- Çalışma alanında doğal ya da suni bir havalandırma sistemi oluşturun.
- Kaynak ve kesme işlemi yapılan yerlerde uygun bir duman emme sistemi kullanın. Gerekliyorsa tüm atölyede biriken duman ve gazları dışarıya atabilecek bir sistem kurun. Deşarj esnasında çevreyi kirletmemek için uygun bir filtrasyon sistemi kullanın.
- Dar ve kapalı alanlarda çalışıysanız veya kurşun, berilyum, kadmiyum, çinko, kaplı ya da boyali malzemelerin kaynağını yapıyorsanız, yukarıdaki önlemlere ilave olarak temiz hava sağlayan maske-ler kullanın.
- Gaz tüpleri ayrı bir bölgede gruplandırılmışa buraların iyi havalandmasını sağlayın, gaz tüpleri kullanıldıkça ana vanalarını kapalı tutun, gaz kaçaklarına dikkat edin.
- Argon gibi koruyucu gazlar havadan daha yoğundur ve kapalı alanlarda kullanıldıkları takdirde havanın yerine solunabilirler. Bu da sağlığınız için tehlikelidir.
- Kaynak işlemlerini yağlama veya boyama işlemlerinde açığa çıkan klorlu hidrokarbon buharlarının olduğu ortamlarda yapmayın.

 
Ark İşiği**Gözlerinize ve Cildinize****Zarar Verebilir**

- Gözlerinizi ve yüzünüzü korumak için uygun koruyucu maske ile ona uygun (EN 379'a göre 4 İla 13) cam filtre kullanın.

- Vücutunuzun diğer çiplak kalan yerlerini (kollar, boyun, kulaklar, vb) uygun koruyucu giysilerle bu işnlardan koruyun.

- Çevrenizdeki kişilerin ark işnlarından ve sıcak metallerden zarar görmemeleri için çalışma alanınızı göz hizasından yüksek, aleve dayanıklı paravanlarla çevirin ve uyarı levhaları asın.

- Buz tutmuş boruların istilimesinde kullanılmaz. Kaynak makinesiyle yapılan bu işlem tesisatinizda patlama, yanım veya hasara neden olur.

Kivilcimler ve Sıçrayan**Parçalar Gözlerinizi****Yaralayabilir**

- Kaynak yapmak, yüzey taşlamak, fırçalamak gibi işlemler kivilcimlara ve metal parçacıklarının sıçramasına neden olur. Oluşabilecek yaralanmaları önlemek için kaynak maskesinin altına, kenar korumalarıyla olan onaylanmış koruyucu iş gözlükleri takın.

**Sıcak Parçalar Ağır****Yanıklara Neden Olabilir**

- Sıcak parçalara çiplak el ile dokunmayın.

- Makinenin parçaları üzerinde çalışmadan önce soğumaları için gerekli sürenin geçmesini bekleyin.

- Sıcak parçaları tutmanız gerektiğinde, uygun alet, ıslı izolasyonu yüksek kaynak eldiveni ve yanmaz giysiler kullanın.

Gürültü, Duyma**Yeteneğinize****Zarar Verebilir**

- Bazi ekipman ve işlemlerin oluşturacağı gürültü, duyma yeteneğinize zarar verebilir.

- Eğer gürültü seviyesi yüksek ise onaylanmış kulak koruyucularını takın.

Kaynak Teli Yaralanmaları**Yol Açıbilir**

- Kaynak teli sargasını boşaltırken torcu vücudun herhangi bir bölümüne, diğer kişilere ya da herhangi bir metale doğru tutmayın.
- Kaynak telini makaradan elle açarken özellikle ince çaplarında tel, bir yay gibi elinizden fırlayabilir, size veya çevrenizdeki diğer kişilere zarar verebilir, bu işlemi yaparken özellikle gözlerinizi ve yüzünü koruyun.

**Kaynak İşlemi
Yangınlara ve
Patlamalarla Yol Açıbilir**

- Yanıcı maddelere yakın yerlerde kesinlikle kaynak yapmayın. Yangın çıkabilir veya patlamalar olabilir.
- Kaynak işlemeye başladan önce bu maddeleri ortamdan uzaklaştırın veya yanmalarını ve harımlarını önlemek için koruyucu örtülerle üstlerini örtün.
- Bu alanlarda ulusal ve uluslararası özel kurallar geçerlidir.



- Tamamen kapalı tüplere ya da borulara kaynak ve kesme işlemi uygulamayın.
- Tüp ve kapalı konteynerlere kaynak yapmadan önce bunları açın, tamamıyla boşaltıp, havalandırıp temizleyin.
- Bu tip yerlerde yapacağınız kaynak işlemlerinde mümkün olan en büyük dikkati gösterin.
- İçinde daha önce, patlama, yangın ya da diğer tepkimelere neden olabilecek maddeler bulunan tüp ve borulara boş dahi olsalar kaynak yapmayın.
- Kaynak ekipmanları isnınırlar. Bu nedenle kolay yanabilecek veya hasar görebilecek yüzeylerin üzerine yerleştirimeyin!



- Kaynak kuvuçları yanına sebep olabilir. Bu nedenle yanın söndürücü tüp, su, kum gibi malzemeleri kolay ulaşabileceğiniz yerlerde bulundurun.
- Yanıcı, patlayıcı ve basınclı gaz devreleri üzerinde geri tepme ventilleri, gaz regülatörleri ve vanalarını kullanın. Bunların periyodik kontrollerinin yapılp sağlıklı çalışmasına dikkat edin.

**Makineler ve Aparatlar
Yetkisiz Kişiler Tarafından
Bakım Yapılması
Yaralanmaları
Neden Olabilir**

- Elektrikli cihazlar yetkisiz kişilere tamir ettilirmemelidir. Burada yapılabilecek hatalar kullanımda ciddi yaralanmalar veya ölümlere neden olabilir.
- Gaz devresi elementleri basınç altında çalışmaktadır; yetkisiz kişiler tarafından verilen servisler sonucunda patlamalar olabilir, kullanıcılar ciddi şekilde yaralanabilir.
- Makinanın ve yan birimlerinin her yıl en az bir kez teknik bakımının yaptırılması tavsiye edilir.

**Küçük hacimli
Kapalı Alanlarda Kaynak**

- Küçük hacimli ve kapalı alanlarda mutlaka bir başka kişi eşliğinde kaynak ve kesme işlemlerini yapın.
- Mممكىن olduğu kadar bu tarz kapalı yerlerde kaynak ve kesme işlemleri yapmaktan kaçının.

**Taşıma Esnasında
Gerekli Önlemlerin
Alınmaması
Kazalara Neden Olabilir**

- Makinenin taşınmasında gerekli tüm önlemleri alınır. Taşıma yapılacak alanlar, taşımada kullanılacak parçalar ile taşımayı gerçekleştirecek kişinin fiziki koşulları ve sağlığı taşıma işlemine uygun olmalıdır.
- Bazı makineler son derece ağırdır, bu nedenle yerleri değiştirirken gerekli çevresel güvenlik önlemlerinin alındığından emin olunmalıdır.
- Kaynak makineleri bir platform üzerinden kullanılacaksa, bu platformun uygun yük taşıma sınırlarına sahip olduğu kontrol edilmelidir.
- Bir vasıtaya yardımı ile (taşıma arabası, forklift vb.) taşınacak ise vasıtanın ve makineyi vasıtaya bağlayan bağlantı noktalarının (taşma askısı, kayış, civata, somun, tekerlek vb.) sağlamlığından emin olunuz.
- Elle taşıma işlemi gerçekleştirilecek ise Makine aparatlarının (taşma askısı, kayış vb.) ve bağlantılarının sağlamlığından emin olunuz.

- Gerekli taşıma koşullarının sağlanması için Uluslararası Çalışma Örgütünün taşıma ağırlığı ile ilgili kurallarını ve ülkenizde var olan taşıma yönetmeliklerini göz önünde bulundurunuz.
- Güç kaynağının yerini değiştirirken her zaman tutamakları veya taşıma halkalarını kullanın. Asla torç, kablo veya hortumlardan çekmeyin. Gaz tüplerini mutlaka ayrı taşıyın.
- Kaynak ve kesme ekipmanlarını taşımadan önce tüm ara bağlantılarını söküp, ayrı ayrı olmak üzere, küçük olanları saplarından, büyükleri ise taşıma halkalarından ya da forklift gibi uygun kaldırma ekipmanları kullanarak kaldırın ve taşıyın.

**Düşen Parçalar Yarananmalara
Sebepli Olabilir**



Güç kaynağının ya da diğer ekipmanların doğru konumlandırılmaması, kişilerde ciddi yarananmalara ve diğer nesnelerde maddi hasara neden olabilir.

- Makinenizi düşmeyecek ve devrilmeyecek şekilde maksimum 10° eğime sahip zemin ve platformlara yerleştirin. Malzeme akşina engel olmayacağı, kablo ve hortumlara takılma riskinin oluşmayacağı, hareketsiz; ancak geniş, rahat havalandırılabilen, tozsuz alanları tercih edin. Gaz tüplerinin devrilmemesi için tüpe uygun gaz platformu bulunan makinelerde platformun üzerine, sabit kullanımlarda ise devrilmeyecek şekilde zincirle duvara sabitleyin.
- Operatörlerin makine üzerindeki ayarlarla ve bağlantılarla kolayca ulaşmasını sağlayın.

Aşırı Kullanım Makinenin

- Çalışma çevrimi oranlarına göre makinenin soğumasına müsaade edin.

Aşırı Isınmasına

- Akımı veya çalışma çevrimi oranını tekrar kaynağı başlamadan önce düşürün.

Neden Oetur



- Makinenin havalandırma girişlerinin öünü kapamayın.

- Makinenin havalandırma girişlerine, üretici onayı olmadan filtre koymayın.

Ark Kaynağı

- Bu cihaz TS EN 55011 standartında göre EMC testlerinde grup 2, class A dir.

Elektromanyetik Parazitlere

- Bu class A cihaz elektriksel gücün alçak gerilim şebekeden sağlandığı meskun mahallelerde kullanım amacıyla üretilmemiştir. Bu gibi yerlerde iletilen ve yayılan radyo frekans parazitlerinden dolayı elektromanyetik uyumluluğu sağlamak ilgili muhafemel zorluklar olabilir.

Neden Oetur



- Bu cihaz IEC 61000 -3 - 12 uyumlu değildir. Evlerde kullanılan alçak gerilim şebekesine bağlanmak istenmesi durumunda, elektrik bağlantısını yapacak tesisatının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.

- Çalışma bölgesinin elektromanyetik uyumluluğu (EMC) uygun olduğundan emin olun. Kaynak veya kesme işlemi esnasında olusabilecek elektromanyetik parazitler, elektronik cihazlarınızda ve şebekeinizde istenmeyen etkilere neden olabilir. İşlem sırasında olusabilecek bu parazitlerin neden olabileceği etkiler kullanıcının sorumluluğu altındadır.
- Eğer herhangi bir parazit oluşuyorsa, uygunluğu sağlamak için; kısa kablo kullanımı, kormalı (zırhlı) kablo kullanımı, kaynak makinesinin başka bir yere taşınması, kabloların etkilenen cihaz ve/veya bölgeden uzaklaştırılması, filtre kullanımı veya çalışma alanının EMC açısından korunmaya alınması gibi ekstra önlemler alınabilir.
- Olası EMC hasarlarını engellemek için kaynak işlemlerini hassas elektronik cihazlarınızdan mümkün olduğunda uzakta (100m) gerçekleştirin.
- Kaynak kesme makinenizin kullanma kılavuzuna uygun şekilde kurulup yerleştirildiğinden emin olun.

**Çalışma Alanının
Elektromanyetik Uygunluğunun
Değerlendirilmesi**



IEC 60974-9 madde 5.2'ye göre;

Kaynak ve Kesme donanımı tesis etmeden önce, işletme yetkilisi ve/veya kullanıcı, çevredeki olası elektromanyetik parazitler hakkında bir inceleme yapmalıdır. Aşağıda belirtilen haller göz önünde bulundurulmalıdır;

- a) Kaynak makinesi ve donanımının üstünde, altında ve yanındaki diğer besleme kabloları, kontrol kabloları, sinyal ve telefon kabloları,
- b) Radyo ve televizyon vericileri ve alıcıları,
- c) Bilgisayar ve diğer kontrol donanımı,
- d) Kritik güvenlik donanımı, örneğin endüstriyel donanımın korunması,
- e) Çevredeki insanların tıbbi aparatları, örneğin kalp pilleri ve işitme cihazları,
- f) Ölçme veya kalibrasyon için kullanılan donanım,
- g) Ortamındaki diğer donanımın bağılılığı. Kullanıcı, çevrede kullanılmakta olan diğer donanımın uyumlu olmasını sağlamalıdır. Bu, ilave koruma önlemleri gerektirebilir,
- h) Kaynak işleminin ya da diğer faaliyetlerin gün içindeki gerçekleştirileceği zaman, göz önüne alınarak çevrenin büyüklüğü, binanın yapısına ve binada yapılmakta olan diğer faaliyetlere göre inceleme alanı sınırları genişletilebilir.

Alanın değerlendirilmesine ek olarak cihaz kurulumlarının değerlendirilmesi de bozucu etkinin çözümü için gerekli olabilir.

Gerek görülmeyeceğinde, yerinde ölçümler azaltıcı önlemlerin verimliliklerini onaylamak için de kullanılabilir.

(Kaynak: IEC 60974-9).

**Parazit Azaltma
Yöntemleri**



- Cihaz tavsiye edilen şekilde ve yetkili bir kişi tarafından elektrik şebekesine bağlanmalıdır. Eğer parazit olursa şebekenin filtrelenmesi gibi ek önlemler uygulanabilir. Sabit montajlı ark kaynağı ekipmanının beslemesi metal bir boru içerisinde veya esdeger ekranlı bir kablo ile yapılmalıdır. Ekran ile güç kaynağının mahfazası bağlı olmalı ve bu iki yapı arasında iyi bir elektriksel temas sağlanmalıdır.
- Cihazın tavsiye edilen rutin bakımları yapılmalıdır. Cihaz kullanıldayken, kaportaın tüm kapakları kapalı ve/veya kilitli olmalıdır. Cihaz üzerinde üreticinin yazılı onayı olmadan standart ayarları dışında herhangi bir değişiklik, modifikasyon kesinlikle yapılamaz. Aksi durumda oluşabilecek her türlü sonuçtan kullanıcı sorumludur.
- Kaynak kabloları mümkün olduğunda kısa tutulmalıdır. Çalışma alanının zemininden yan yana olacak şekilde ilerlemelidirler. Kaynak kabloları hiçbir şekilde sarılmamalıdır.
- Kaynak esnasında makinede manetik alan oluşmaktadır. Bu durum makinenin metal parçaları kendi üzerine çekmeye sebebiyet verebilir. Bu çekimi engellemek adına metal malzemelerin güvenli mesafede veya sabitlenmiş olduğundan emin olunuz. Operatör, bütün bu birbirine bağlanmış metal malzemelerden yarılılmalıdır.
- İş parçasının elektriksel güvenlik amacıyla veya boyutu ve pozisyonu sebebiyle topraka bağlanması gereken durumlarda (örneğin gemi gövdesi veya çelik konstrüksiyon imalatı) iş parçası ile toprak arasında yapılacak bir bağlantı bazı durumlarda emisyonları düşürebilir. İş parçasının topraklanmasının kullanıcıların yaralanmasına veya ortamındaki diğer elektrikli ekipmanların arızayamasına neden olabileceği unutulmamalıdır. Gerekli hallerde iş parçası ile toprak bağlantısı doğrudan bağlantı şeklinde yapılabilir fakat doğrudan bağlantıya izin verilemeyen bazı ürkelerde bağlantı yerel düzenevine ve yönetmeliklere uygun olarak, uygun kapasite elemanları kullanılarak oluşturulabilir.
- Çalışma alanındaki diğer cihazların ve kabloların ekranlanması ve muhafazası bozucu etkilerin önüne geçilmesini sağlayabilir. Kaynak bölgesinin tamamının ekranlanması bazı özel uygulamalar için değerlendirilebilir.

- Ark Kaynağı Elektronmanyetik Alana (EMF) Neden Olabilir**
- Herhangi bir iletken üzerinden geçen elektrik akımı, bölgesel elektrik ve manyetik alanlar (EMF) oluşturur. Bütün kaynakçalar, kaynak devresinden gelen EMF'ye maruz kalmanın sebep olduğu riski en azı indirmek için aşağıdaki prosedürleri uygulamalıdır;
- Manyetik alanı azaltmak adına kaynak kabloları bir araya getirilmeli, mümkün olduğunda birleştirici malzemelerle (bant, kablo bağı vb.) emniyet altında alınmalıdır.
 - Kaynakçının/calışanın gövdesi ve başı, kaynak makine ve kablolarından mümkün olduğunda uzakta tutulmalıdır,
 - Kaynak kabloları vücudun etrafına hiçbir şekilde sarılmamalıdır,
 - Vücut, kaynak kablolarının arasında kalmamalıdır. Kaynak kablolarının her ikisi yan yana olmak üzere vücudun uzağında tutulmalıdır,
 - Dönüş kablosu iş parçasına, kaynak yapılan bölgeye mümkün olduğunda yakın bir şekilde bağlanmalıdır,
 - Kaynak güç ünitesine yaslanmamalı, üzerine oturmamalı ve çok yakınında çalışılmamalıdır,
 - Kaynak teli besleme birimi veya kaynak güç ünitesini taşıırken kaynak yapılmamalıdır.
- EMF ayrıca, kalp pilleri gibi tıbbi implantların (vücut içine yerleştirilen madde) çalışmasını bozabilir. Tıbbi implantları olan kişiler için koruyucu önlemler alınmalıdır. Örneğin, yoldan geçenler için erişim sınırlaması koyulabilir veya kaynakçalar için bireysel risk değerlendirmeleri yapılabilir. Bir tıp uzmanı tarafından, tıbbi implantları olan kullanıcılar için risk değerlendirmesi yapılp, öneride bulunulmalıdır.
-
- Koruma**
- 
- Makineyi yağmura maruz bırakmayın, üzerine su sıçramasına veya basınçlı buhar gelmesine engel olun.
-
- Enerji Verimliliği**
- 
- Yapacağınız kaynağa uygun kaynak yöntemi ve kaynak makinesi tercihinde bulunun.
 - Kaynak yapacağınız malzemeye ve kalınlığına uygun kaynak akımı ve/veya gerilimi seçin.
 - Kaynak yapmadan uzun süre beklenilecekle, fan makineyi soğuttuktan sonra makineyi kapatın. Akıllı fan kontrolü olan makinelerimiz (ürünlerimiz) kendi kendine duracaktır.
-
- Atık Prosedürü**
- 
- Bu cihaz evsel atık değildir. Avrupa Birliği direktifi ile ulusal yasa çerçevesinde geri dönüşüme yönlendirilmek zorundadır.
 - Kullanılmış makinenizin atık yönetimi hakkında satıcınızdan ve yetkili kişilerden bilgi edinin.

TEKNİK BİLGİLER

TR


1.1 Genel Açıklamalar

MEGASTICK, doğru akım çıkışlı (DC), monofaze invertör teknolojisi ile üretilmiş, 4.00 mm ye kadar örtülü elektrod yakabilen, kolay taşınabilir 200A kaynak makinesidir.

Valfli bir TIG Torcu ile tungsten ucun iş parçasına değerlendirerek ark başlatılması yöntemi ile DC TIG kaynak makinesi olarak da kullanılabilir.*
Jeneratör ile çalışmaya uyumludur. 25 metre uzunluğa kadar kaynak kablolarıyla da kullanılabilir. Fan soğutmalı ve aşırı ısınmaya karşı termik korumalıdır.

(*)TIG kaynağı hakkında daha fazla bilgi için sayfa 32 e göz atın.

1.2 Makine Bileşenleri

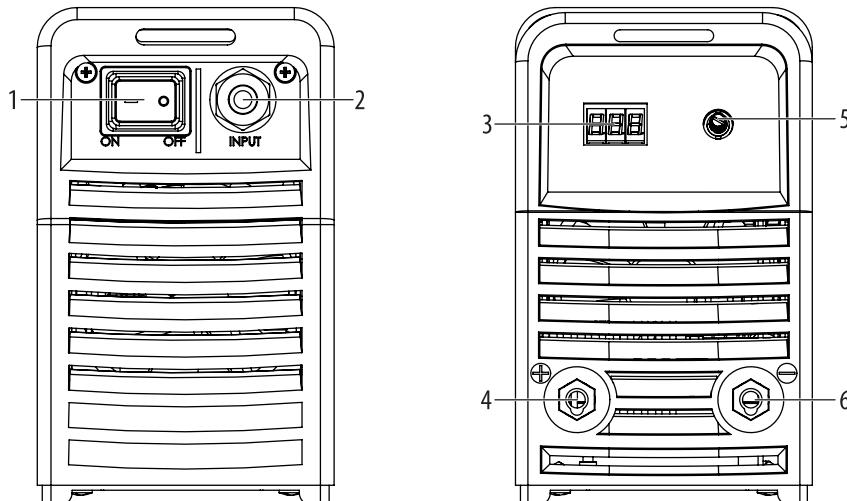

Şekil 1: MEGASTICK


- 1- Açma / Kapama Düğmesi
- 2- Besleme Kablosu Girişи
- 3- Dijital Göstergе

- 4- Kaynak ve Toprak Kablosu Soketi (+)
- 5- Akım Ayar Düğmesi
- 6- Kaynak ve Toprak Kablosu Soketi (-)

1.3 Ürün Etiketi

MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.			
Organize Sanayi Bölgesi 5.Kısim Manisa-TÜRKİYE			
MEGASTICK		Seri No :	
		10A / 20.4V - 200A / 28V	
X	14%	60%	100%
I ₂	200A	100A	85A
U ₂	28V	24V	23.4V
I ₁	42.1A	19.8A	15.6A
S ₁	9.68 kVA	4.55kVA	3.59kVA
	U ₁ =230V 1~50-60 Hz	I _{1max} = 42.1A	I _{1eff} = 15.76A
	IP23S		

	Tek Fazlı Static Frekans Çevirici Transformator Doğrultucu
	Örtülü Elektrod Kaynağı
	Doğru Akım
	Düsey Karakteristik
	Şebeke Girişisi-1 Fazlı Alternatif Akım
	Tehlikeli Ortamlarda Çalışmaya Uygun
X	Çalışma Çevrimi
U ₀	Boşta Çalışma Gerilimi
U ₁	Şebeke Gerilimi ve Frekansı
U ₂	Anma Kaynak Gerilimi
I ₁	Şebekeden Çekilen Anma Akımı
I ₂	Anma Kaynak Akımı
IP23S	Koruma Sınıfı
S ₁	Şebekeden Çekilen Güç

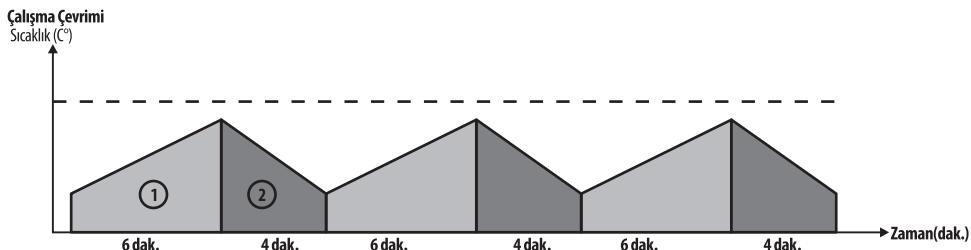

EN 60974-1 standardında da tanımladığı üzere çalışma çevrim oranı 10 dakikalık bir zaman periyodu içerir. Örneğin %60'da 250A olarak belirtilen bir makinede 250A'de çalışılmak isteniyorsa, makine 10 dakikalık zaman periyodunun ilk 6 dakikasında hiç durmadan kaynak yapabilir (1 bölgisi). Ancak bunu takip eden 4 dakika makine soğuması için boşta bekletilmelidir (2 bölgisi).

1.4 Teknik Özellikler

TEKNİK ÖZELLİKLER	BİRİM	DEĞER
Şebeke Gerilimi (1 faz - 50-60 Hz)	V	230
Şebekeden Çekilen Güç (%14)	kVA	9,68
Şebekeden Çekilen Akım (%14)	A	42,1
Güç Faktörü		0,67
Boşta Çalışma Gerilimi	VDC	75
Kaynak Akım Ayar Sahası	ADC	10-200
Anma Kaynak Akımı (%14)	ADC	200
Koruma Sınıfı		IP23S
Soğutma Sistemi		Hava
Boyunlar (UxGxY)	mm	360x120x200
Ağırlık	kg	5
Sigorta	A	50
Standart ve Onaylar		CE,EN60974-1,EN60974-10

1.5 Aksesuarlar

STANDART AKSESUALRALAR

Megastick

(Kutulu Versiyon İçin)	ADET	ÜRÜN KODU
Elektrod Pensesi ve Kablosu	1	7906102502
Topraklama Pensesi ve Kablosu	1	7905102502

Megastick Deluxe

(Çantalı Versiyon İçin)

	ADET	ÜRÜN KODU
Elektrod Pensesi ve Kablosu	1	7906102502
Topraklama Pensesi ve Kablosu	1	7905102502
Tel Fırça / Çekiç	1	8369000175
El Maskesi	1	8502301007
Elektrod (Paket)	1	11101NAEM1

KURULUM BİLGİLERİ

2.1 Teslim Alırken Dikkat Edilecek Hususlar

Sipariş ettiğiniz tüm malzemelerin gelmiş olduğundan emin olun. Herhangi bir malzemenin eksik veya hasarlı olması halinde derhal aldiğiniz yer ile teması geçin.

Standart kutu şunları içermektedir:

- Ana makine ve ona bağlı şebeke kablosu
- Topraklama pensesi ve kablosu
- Elektrod pensesi ve kablosu
- Aski Kayışı
- Garanti belgesi
- Kullanım kılavuzu

Standart çantalı versiyon şunları içermektedir:

- Ana makine ve ona bağlı şebeke kablosu
- Topraklama pensesi ve kablosu
- Elektrod pensesi ve kablosu
- Tel fırça / Çekici
- Kaynak el maskesi
- Kullanım kılavuzu

Hasarlı teslimat halinde tutanak tutun, hasarın resmini çekin, ırsaliyenin fotokopisi ile birlikte nakliyeci firmaya bildirin. Sorunun devam etmesi halinde müşteri hizmetleri ile irtibata geçin.

Cihaz üzerindeki simboller ve anımları;



Kaynak yapma işlemi tehlike içermektedir. Uygun çalışma koşulları sağlanmalı ve gerekli önlemler alınmalıdır. Uzman kişiler makinede sorumlu olup, gerekli donanımları sağlamalıdır. İlgili olmayan kişiler kaynak sahasından uzak tutulmalıdır.



Bu cihaz IEC 61000-3-12 uyumlu değildir. Evlerde kullanılan alçak gerilim şebekesine bağlanmak istenmemiş durumunda, elektrik bağlantı-sını yapacak tesisatının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.



Cihaz üzerinde ve kullanım kılavuzunda bulunan güvenlik sembollerine ve uyarı notlarına dikkat edilmeli, etiketleri sökülmemelidir.



Izgaralar havalandırma amaçlıdır. Açıklıkların üzeri iyi bir soğutma sağlamak amacıyla örtülmemeli ve içeriye yabancı cisim sokulmamalıdır.

2.2 Kurulum ve Çalışma Tavsiyeleri

Daha iyi performans için, makineyi çevresindeki nesnelerden en az 30 cm uzağa yerleştirin. Makine çevresindeki aşırı ısınma, toz ve neme dikkat edin. Makineyi direk güneş ışığı altında çalıştırmayın. Ortam sıcaklığının 40 °C'yi aşığı durumlarda, makineyi daha düşük akımda ya da daha düşük çalışma çevrim oranında çalıştırın.

Diş mekanlarda rüzgar ve yağmur varken kaynak yapmaktan kaçının. Bu tür durumlarda kaynak yapmak zorunluysa, kaynak bölgesini ve kaynak makinesini perde ve tenteye koruyun. İçerde kaynak yapıyorsanız, uygun bir duman emme sistemi kullanın. Kapalı mekanlarda kaynak dumanı ve gazı soluma riski varsa, solunum aparatları kullanın.

Ürün etiketine belirtilen çalışma çevrimi oranlarına uyun. Çalışma çevrimi oranlarını sıkılıkla asmak, makineye hasar verebilir ve bu durum garantiyi geçersiz kıllırbilir.

Sisteminize uygun sigortayı kullanın.

Toprak kablosunu kaynak bölgesinin olabildiğince yakınına, sıkıcı bağlayın.

Kaynak akımının kaynak kabloları dışındaki ekipmanlar üzerinden geçmesine izin vermeyin.

Gaz tüpünü zincirle duvara sabitleyin.

Çalışma sırasında kaynak kabloları ve şebeke kablosu makine gövdesine sarılı olmamalıdır.

2.3 Örtülü Elektrod ve TIG Kaynağı İçin Bağlantılar

TR




*Makineyi şebekeye bağlamadan önce şebekede doğru gerilimin olup olmadığını kontrol edin.
Fişi prize takarken, açma/kapama düğmesinin kapalı konumda "0" olduğundan emin olun.*

Örtülü elektrod kaynağı için:


- Açma/kapama düğmesi (1) ile makineyi çalıştırın ve soğutma fanının çalışıp çalışmadığını kontrol edin.
- Kaynak ve topraklama kablolarını kullanıacak elektroda ve elektrodun üreticisinin tavsiye ettiği kutuplara göre kaynak ve toprak kablosu soketlerine (4-6) takip saat yönünde çevirerek sıkın.
- Toprak pensesini kaynak bölgesine olabildiğince yakın olacak şekilde iş parçasına bağlayın.

TIG kaynağı için:

- Açma/kapama düğmesi (1) ile makineyi çalıştırın ve soğutma fanının çalışıp çalışmadığını kontrol edin.
- Gaz valfli bir TIG torcu kullanılmalıdır.
- TIG torcunu güç kablosunu eksiz kutuplu sokete (6) bağlayın ve topraklama kablosunu artı kutuplu sokete (4) bağlayın.
- Argon gaz regülatörünü argon gaz tüpüne bağlayın.
- Torcun gaz hortumunu gaz regülatörüne bağlayın.

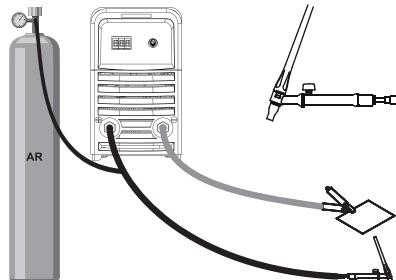

Şekil 2: TIG Kaynağı Bağlantıları

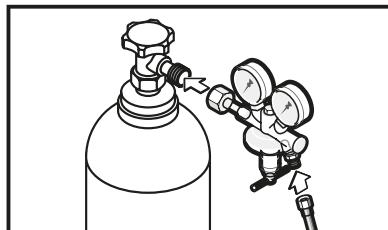

Şekil 3: Gaz Tüpü Bağlantısı


Aşağıdaki tablo alaşımzsız çeliklerin amper ayarı için referans olarak verilmiştir. Lütfen elektrod üreticisinin tavsiyelerine uyunuz.

Örtülü Elektrod Çapı (mm)	Tavsiye Edilen Kaynak Akımı	
	Rutil	Bazık
2.0	40-60 A	-
2.5	60-90 A	60-90 A
3.2	100-140 A	100-130 A
4.0	140-180 A	140-180 A

KULLANIM BİLGİLERİ

3.1 Kullanıcı Arayüzü

TR

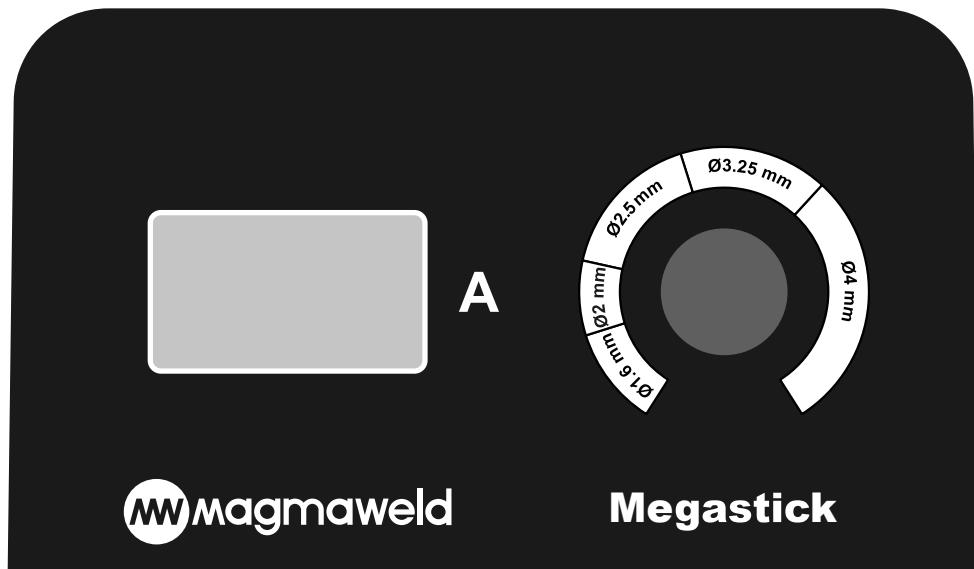**Mmagmaweld****Megastick**

	Kullanıcı dostu arayüze sahip Megastick kontrol panelinde dijital gösterge ve akım ayar potu bulunmaktadır.
 A	Dijital Gösterge <ul style="list-style-type: none">Akım değeri dijital panel üzerinden izlenmektedir.
	Akım Ayar Potu <ul style="list-style-type: none">Akım ayar potunun etrafında akım ayar skaları bulunmaktadır. Bu akım ayar skaları ile yarmak istediğiniz elektrod çapını seçebilirsiniz.


3.2 Makine Özellikleri

- 10-200 A aralığında kaynak yapan hafif, taşınabilir ve performansı boyutuna göre çok yüksek olan bir MMA makinasıdır.
- Rutil ve bazik elektrod performansları mükemmelidir.
- 5 kg ağırlığı ve küçük ebatlara sahiptir.
- EMC testlerini ve CE gereksinimlerini tamamıyla karşılar.
- Jeneratörlerle çalışmaya uygundur. Seçilecek jeneratör için kVA değeri makinanın teknik özelliklerine (sayfa 30) bakılarak belirlenmelidir.

BAKIM VE ARIZA BİLGİLERİ

TR


- Makineye yapılacak bakım ve onarımın mutlaka yetkin kişiler tarafından yapılması gerekmektedir. Yetkisiz kişiler tarafından yapılacak müdahaleler sonucu oluşan kazalardan firmamız sorumlu değildir.
- Onarım esnasında kullanılacak parçaların yetkili servislerimizden temin edebilirsiniz. Orijinal yedek parça kullanımı makinenizin ömrünü uzatacagi gibi performans kayiplarını engeller.
- Her zaman üreticiye veya üretici tarafından belirtilen yetkili bir servise başvurun.
- Garanti süresi içerisinde üretici tarafından yetkilendirilmemiş herhangi bir girişimde tüm garanti hükümleri geçersiz olacaktır.
- Geçerli güvenlik kurallarına bakım onarım işlemleri sırasında mutlaka uyunuz.
- Tamir için makinenin herhangi bir işlem yapılmadan önce, makinenin elektrik fışını şebekeden ayıranız ve kondansatörlerin boşalması için 10 saniye bekleyiniz.

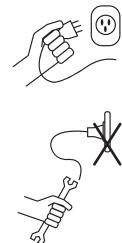

4.1 Bakım


Gündük Bakım

 - Cihaz üzerindeki uyarı etiketlerini sökmeyiniz. Yıpranmış/yırtılmış etiketteri yenisi ile değiştiriniz. Etiketleri yetkili servisten temin edebilirsiniz.
- Penselerin ve Kablolarınızın kontolünü yapınız. Parçaların bağlantılarına ve sağlamlığına dikkat ediniz. Hasar görmüş/arızalı parçaları yeni ile değiştiriniz. Kablolara ek/ onarım kesinlikle yapmayınız.
- Havalandırma için yeterli alan olduğuna emin olun.
- Opsiyonel TIG torcu üzerindeki serif malzemeler düzenli olarak temizlenmelidir. Eğer gerekiyorsa değiştirilmelidir. Bu malzemelerin uzun ömürlü kullanılması için orjinal ürünler olmasına dikkat edilmelidir.



6 Ayda Bir

- Civata, somun gibi birleştirici parçaları temizleyiniz ve sıkıştırınız.
- Elektrod pensesi ve toprak pensesi kablolarnı kontrol ediniz.
- Makinenin yan kapaklarını açarak düşük basınçlı kuru hava ile temizleyiniz. Elektronik parçalara yakın mesafeden basınçlı hava uygulanmamız.

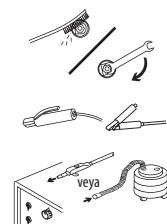

NOT: Yukarıda belirtilen süreler, cihazınızda hiçbir sorunla karşılaşılmaması durumunda uygulanması gereken maksimum periyotlardır. Çalışma ortamınızın yoğunluğuna ve kirliliğine göre yukarıda belirtilen işlemleri daha sık aralıklarla tekrarlayabilirsiniz.


4.2 Hata Giderme

Aşağıdaki tablolarda karşılaşılan olası hatalar ve çözüm önerileri bulunmaktadır.

Hata	Çözüm
Ön paneldeki termik ledi yanıyor	<ul style="list-style-type: none">Makinenin devrede kalma oranı aşılmış olabilir. Bir süre bekleyerek makinenin soğumasını sağlayınız. Arıza ortadan kalkıyor ise daha düşük amper değerlerinde kullanmaya çalışın.Fan çalışmıyor olabilir. Fanın çalışıp çalışmadığını göz ile kontrol ediniz. Çalışmaması durumunda yetkili servis ile irtibata geçiniz.Hava giriş-çıkış kanallarının önyü kapanmış olabilir. Hava kanallarının önyü açınız.Makine çalışma ortamı aşırı sıcak ya da havasız olabilir. Makinenin daha rahat çalışabileceği bir alana yerleştirilmesini sağlayınız.
Makine hiç çalışmıyor	<ul style="list-style-type: none">Makinenin elektriğe bağlı olduğunu emin olunuz.Şebeke bağlantılarının doğru olduğunu kontrol ediniz.Şebeke besleme sigortalarını, şebeke kablosunu ve fişini kontrol ediniz.Açma kapama anahtarlarını kontrol ediniz.Tüm kontrolleri yaptığınız halde sorun devam ediyor ise yetkili servis ile iletişime geçiniz.
Makine kaynak yapmıyor/ kötü yapıyor	<ul style="list-style-type: none">Makinenin topraklama pencesinin iş parçasına bağlı olduğunu emin olunuz.Kabloların sağlamlığından ve bağlantı noktalarının aşınmamış olduğunu emin olunuz.Parametre ve proses seçiminin doğru olduğunu emin olunuz.Seçtiğiniz prosese göre aşağıdaki adımları uygulayınız:<ul style="list-style-type: none">Elektrodun bağlı olması gereken kutubu ve makinede ayarlanması gereken akım değerini kontrol ediniz.Gaz akışının açık olduğunu kontrol ediniz, akışın doğru olduğunu emin olunuz.Tungsten ucun temiz olduğunu emin olunuz.Kaynak torcunun sağlamlığından emin olunuz.Tüm kontrolleri yaptığınız halde sorun devam ediyor ise yetkili servis ile iletişime geçiniz.


EK 1 - YEDEK PARÇA LİSTESİ

TR

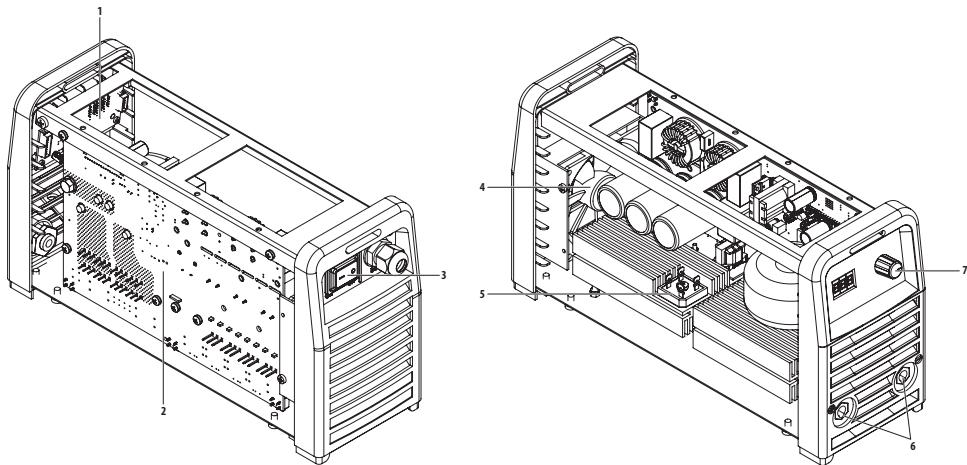


NO	TANIM	MALZEME KODU
1	Elektronik Kart	K405000306
2	Elektronik Kart	K405000308
3	Açma Kapama Anahtarı	A310100011
4	Fan Monofaz	A250001024
5	Köprü Diyot GBPC5010-G	A430901023
6	Kaynak Prizi	A377900103
7	Potans Düğmesi	A229500004
	Hall Effect Sensör	A834000001
	Elektronik Kart	K405000307

+

EK 2 - DEVRE ŞEMASI

TR

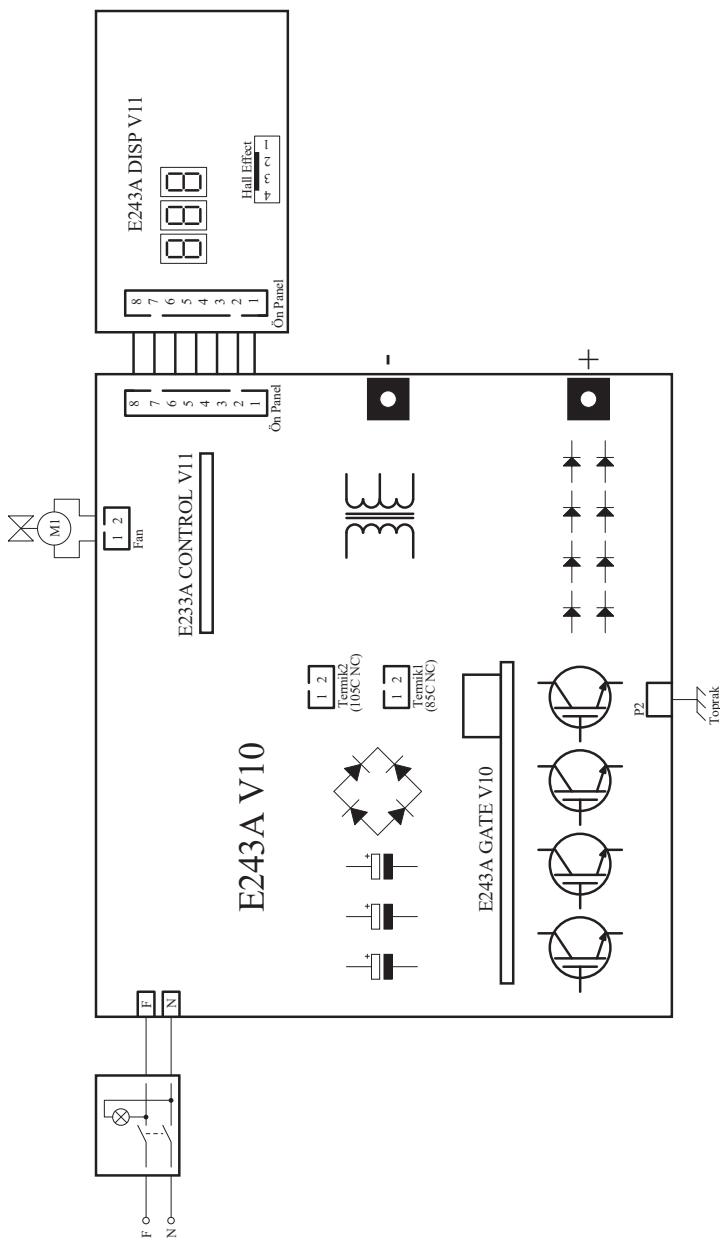



İMALATÇI FİRMA

Organize Sanayi Bölgesi 5. Kısım Yalçın Özaras Caddesi No: 1
45030, MANİSA, Türkiye

T: (+90) 236 226 27 28

Made in TÜRKİYE

01.10.2020

UM_MEGAS_072020_102020_001_40



(+90) 444 93 53
magmaweld.com
info@magmaweld.com